

INSTALLATION INSTRUCTIONS

ReliaMod™ Modular Metering

RM5THJAWISO




**HAZARDOUS VOLTAGE.
WILL CAUSE SEVERE
INJURY OR DEATH.**

Turn OFF power supplying this equipment before working inside.


Please read these instructions completely before installing or removing device. Improper installation could be hazardous to personnel and/or equipment.

Kit Contains:	
Fifth Jaw Assembly	1
Screw	1
Insulator	1

- Turn “OFF” power supplying the meter module.
- Remove the meter cover and meter where the 5th jaw installation will be done.
- Orient isolated fifth jaw assembly in the 6 o'clock or 9 o'clock position.
- Install insulator between the fifth jaw assembly and meter socket base, aligning small hole in insulator with hole in fifth jaw assembly.
- Secure the isolated fifth jaw assembly and insulator with the screw provided to the meter socket base.
- Torques the screw to 25 in lbf.
- Route the white wire to the neutral bar and torque the set screw to 25 in. lbf.

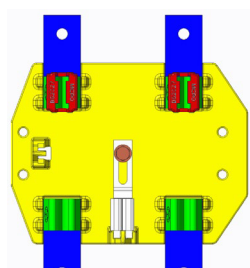

6 o'clock Position

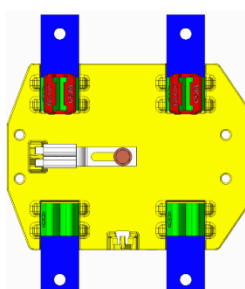

9 o'clock Position

INSTRUCCIONES DE INSTALACIÓN

ReliaMod™ Modular Metering

RM5THJAWISO




**VOLTAJE PELIGROSO.
PODRA CAUSAR MUERTE
O LESIONES SERIAS.**


Desconecte la alimentación eléctrica de este equipo antes de realizar cualquier trabajo dentro o fuera de él.

Lea atentamente estas instrucciones antes de instalar o retirar el dispositivo. Una instalación incorrecta podría resultar peligrosa para el personal y/o el equipo.

El kit contiene:	
Ensamblaje de la quinta mordaza	1
Tornillo	1
Aislador	1

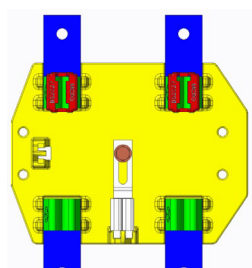

Posición a las 6

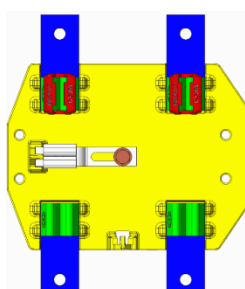

9 en punto Posición

- Desconecta la alimentación del módulo de medición.
- Retira la tapa del contador y el medidor donde se realizará la instalación de la 5ª mordaza.
- Orienta el ensamblaje de la quinta mordaza en la posición de 6 o 9 (mira imagen).
- Instala el aislador entre el conjunto de la quinta mordaza y la base del enchufe del medidor, alineando el orificio pequeño del aislador con el orificio del conjunto de la quinta mordaza.
- Fija el ensamblaje de la quinta mordaza aislada y el aislador con el tornillo suministrado a la base de la toma del medidor.
- Aprieta el tornillo a 25 in-lbf.
- Lleva el cable blanco a la barra neutra y apriete el tornillo de fijación a 25 in-lbf.