

INSTALLATION AND MAINTANANCE INSTRUCTIONS

RXT5SB500



**HAZARDOUS VOLTAGE.
WILL CAUSE SEVERE
INJURY OR DEATH.**

Turn OFF power supplying this
equipment before working inside.

Please read these instructions
completely before installing
or removing device. Improper
installation could be hazardous
to personnel and/or equipment.

Kit Contains



Finger-safe barriers	3
Phase barriers 100 mm	2
Terminal Port Lugs	6

Instruction


Installation of finger-safe barriers

1. Turn OFF power supplying the equipment
2. Remove the line lugs from the breakers.
 - remove set-screws to access M4 screws underneath
 - unfasten M4 screw
 - unfasten M10 screw
 Keep all hardware
3. Install the finger-safe barriers to the lugs

Step 2

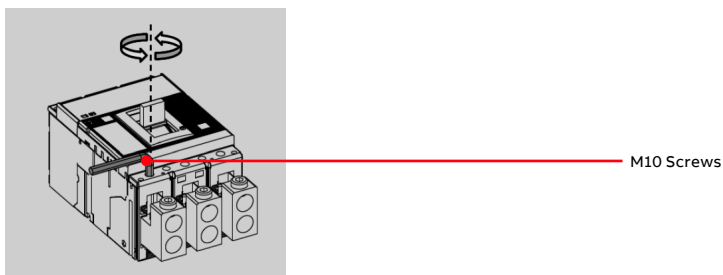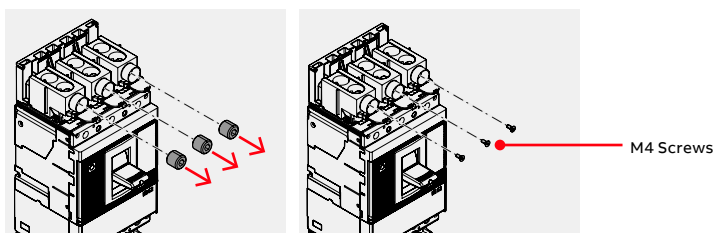


Step 3

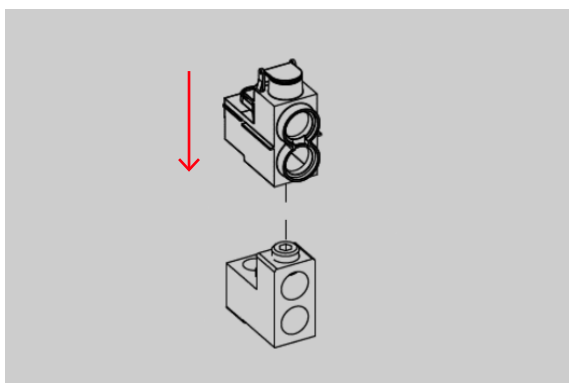


4. Install the lugs assembly to the breaker. Use the hardware from step 2.
Torque M10 bolt (D) to 319 in-lbf
5. Torque M4 screws (E) to 10 in-lbf to fasten the lug to vent plate. Place back the set-screws.
6. Use the provided plugs to close any unused terminal ports.
7. Install two 100 mm phase barriers between the phases in 3PH application


Step 4

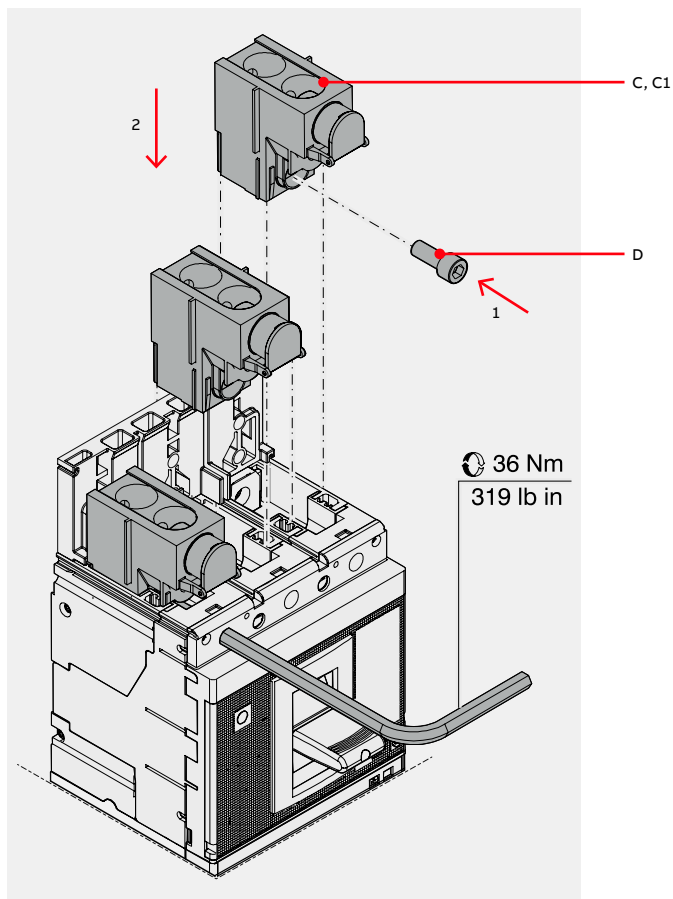

Step 5

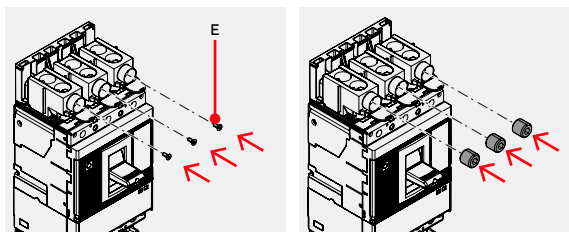

Step 7

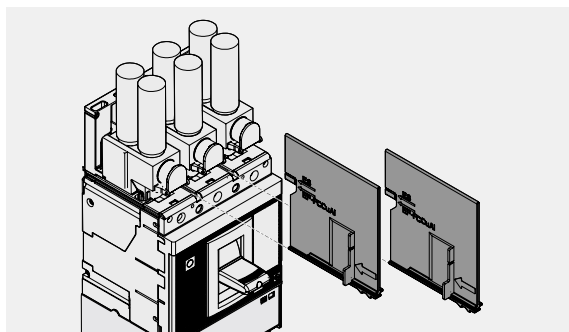

RXT5SB500



**TENSIÓN PELIGROSA.
PROVOCARÁ LESIONES
GRAVES O LA MUERTE.**

Desconecte la alimentación eléctrica
de este equipo antes de trabajar en
su interior.

Lea atentamente estas
instrucciones antes de instalar
o retirar el dispositivo.
Una instalación incorrecta
podría resultar peligrosa para
el personal y el equipo.

El kit contiene



Barreras de seguridad para dedos	3
Barreras de fase de 100 mm	2
Tapones del puerto de terminales	6

Instrucciones


Instalación de barreras de seguridad para dedos

- Desconecte la alimentación del equipo
- Retire los casquillos de línea de los interruptores.
 - retire los tornillos prisioneros para acceder a los tornillos M4 de debajo
 - afloje el tornillo M4
 - afloje el tornillo M10
 Keep all hardware
- Instale las barreras de seguridad para dedos en los casquillos.

Paso 2

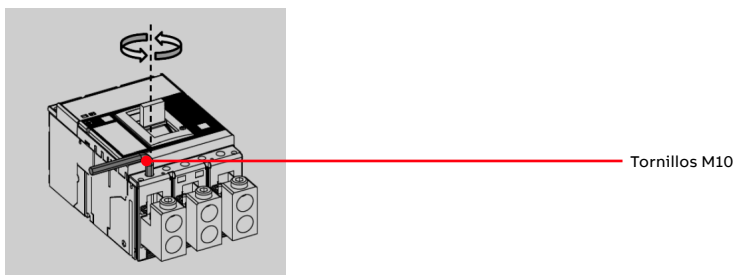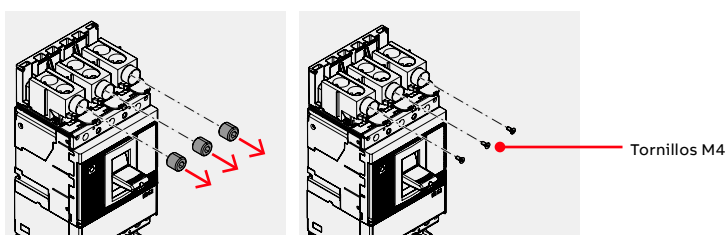


Paso 3

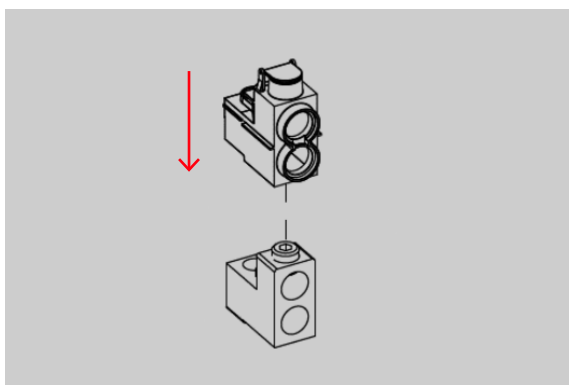


1. Instale el conjunto de casquillos en el interruptor.
Utilice los herrajes del paso 2.
2. Apriete el perno M10 (D) a 319 pulg/lbf.
3. Apriete los tornillos M4 (E) a 10 pulg/lbf para fijar el casquillo a la placa de ventilación. Vuelva a colocar los tornillos prisioneros.
4. Utilice los tapones provistos para cerrar los puertos de terminales que no se utilicen.
5. Instale dos barreras de fase de 100 mm entre las fases en la aplicación 3PH.

Paso 4

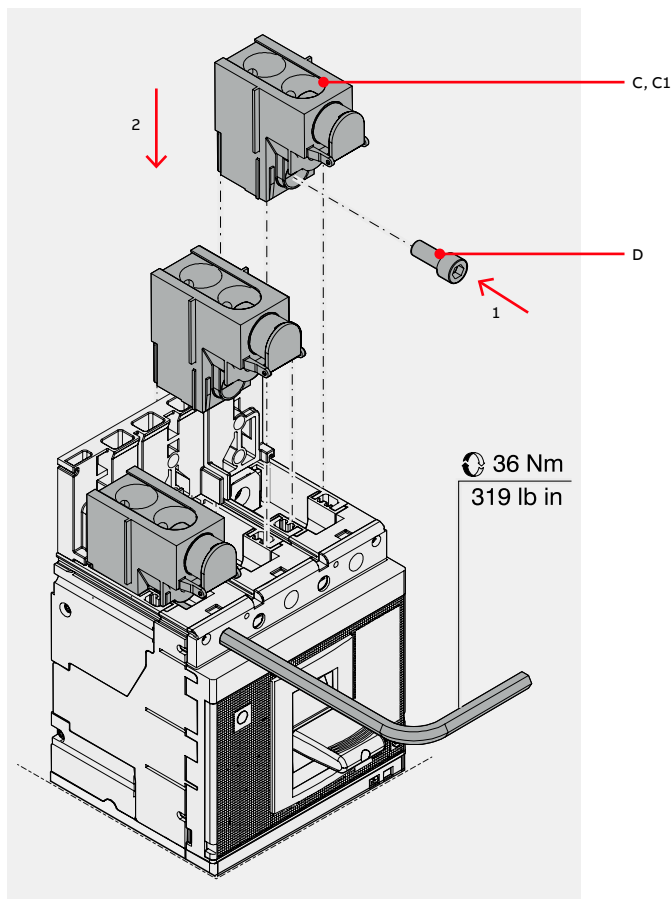

Paso 5

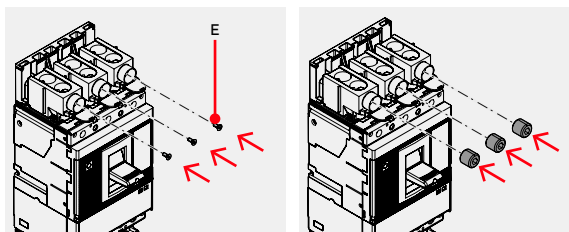

Paso 7

