


PRODUCT INFORMATION

Check of pressure indication and alarm levels for pressure monitor

1. Switch off the supply voltage.
2. Disconnect the pressure sensor from the pressure monitor.
3. Connect one 10 kΩ potentiometer with sliding contact on connection block J1 in the pressure monitor according to Figure.
4. Connect a voltmeter on connection block J1 in the pressure monitor.
5. Switch on the supply voltage.
6. Adjust the voltage according to Table.
7. Compare the displayed pressure with the pressure in Table.
8. Note the displayed pressure when the lamp for each alarm level is lighted.

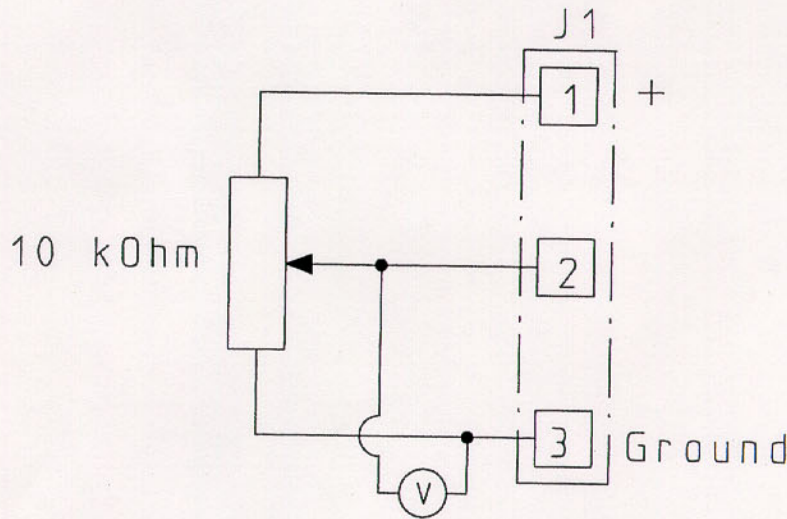

Read voltage on the voltmeter	Overpressure
0 V	- 100 kPa
1 V	0 kPa
2 V	100 kPa
3 V	200 kPa
4 V	300 kPa

This document must not be copied without our written permission, and the contents thereof must not be imparted to a third party nor be used for any unauthorized purpose. Contravention will be prosecuted. ABB Components AB

6917 0500 - LAC Alméns Tr. AB, Ludvika