

ABB CYLON® TECHNICAL BULLETIN 531

Issue Date: 12 January 2024

# FBVi/FBTi v9.3.1 Default Serial Port assignment

Products Affected: FBTi-7T7-1U1R, FBTi-6T1-1U1R, FBVi-2U4-4T-IMP, FBVi-2U4-4T-SI, FBVi-2U4-4T, FBVi-2U4-4T-FA-IMP, FBVi-2U4-4T-FA-SI

## Summary


In v 9.3.1 firmware, FBVi/FBTi serial port is “Unassigned” by default.

**Note:** This will be revised in v 9.3.2 or later.

## Detail

FBVi/FBTi controllers running firmware v 9.3.1 or later allow the selection of either Stat (FusionAir) or Modbus functionality for the serial port.

In version 9.3.1 of the firmware, the port is set to Unassigned by default, so that the functionality must be selected manually in the configuration webpage:

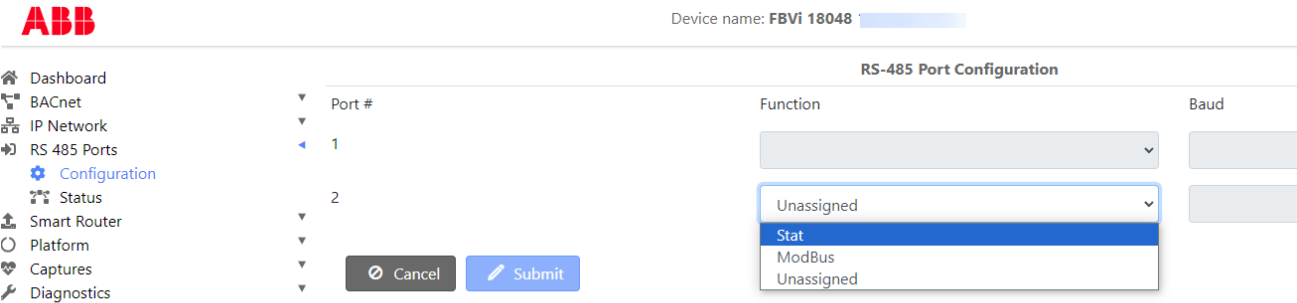

In firmware versions 9.3.2 and later the default functionality will be Stat (FusionAir).

## Customer Impact

Customers who update to v9.3.1 must manually configure the serial ports on all FBVi or FBTi controllers connected to FusionAirs on the site.