


**MAGNETIC FLOWMETERS
50SM1000 Design Level B**

MICROPROCESSOR-BASED SIGNAL CONVERTER

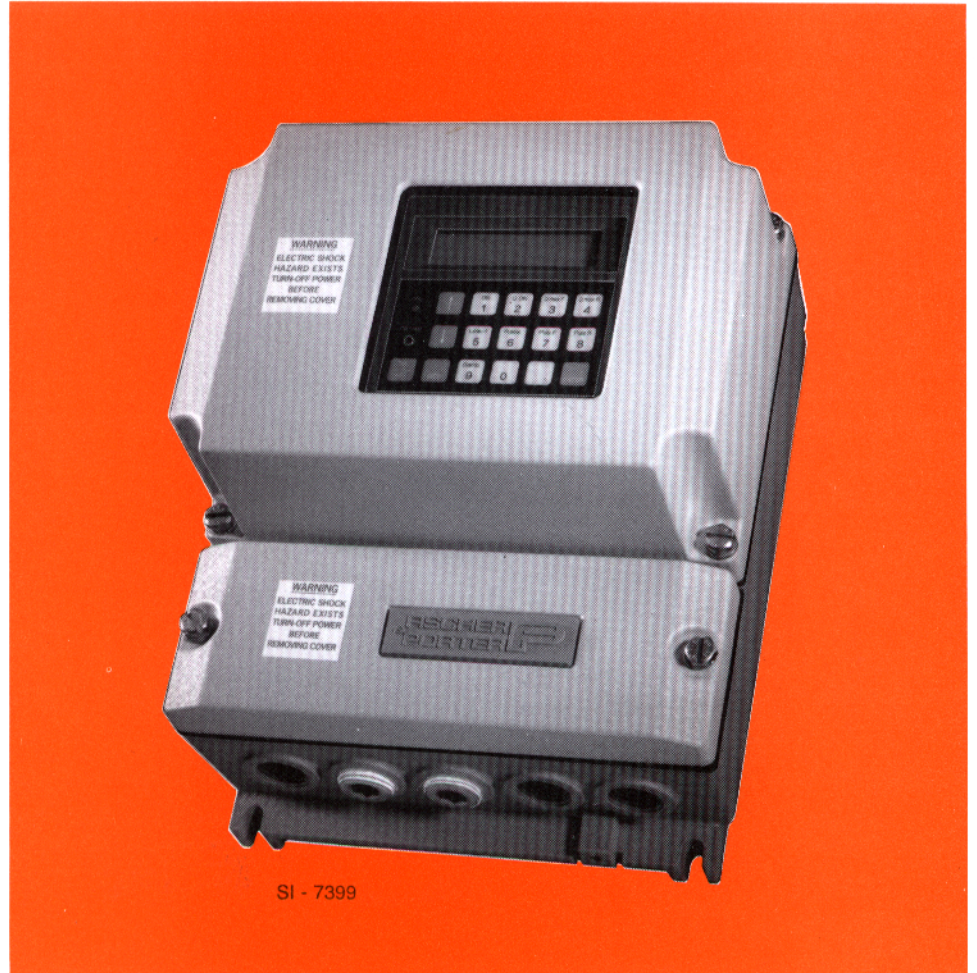

The following are registered trademarks of Fischer & Porter Company:

CHAMELEON®
MAG-X®

The following are trademarks of Fischer & Porter Company:

MICRO-DCI™
SUPERVISOR™
SUPERVISOR-PC™

The following is a registered trademark of Microsoft Corporation:

MS-DOS®

The following is a registered trademark of Rosemount Incorporated:

HART®

**Read these instructions before starting installation;
save these instructions for future reference.**

**All software, including design, appearance, algorithms and source
codes, is copyrighted by Fischer & Porter Company and is owned by
Fischer & Porter Company or its suppliers.**

NOTICE

**The instructions given herein cover generally the description,
installation, operation and maintenance of subject equipment. Fischer &
Porter reserves the right to make engineering refinements that may not
be reflected in this bulletin. Should any questions arise which may not
be answered specifically by these instructions, the questions should be
directed to Fischer & Porter for further detailed information and
technical assistance. The material in this manual is for informational
purposes and is subject to change without notice. Fischer & Porter
Company assumes no responsibility for any errors that may appear in
this manual.**

Table of Contents

READ FIRST	1
1.0 INTRODUCTION	1-1
1.1 General Description	1-1
1.2 Model Number Breakdown	1-4
1.3 Specifications	1-6
2.0 INSTALLATION	2-1
2.1 Inspection	2-1
2.2 Location and Mounting	2-1
2.3 Electrical Interconnections	2-3
2.3.1 Remotely Mounted Signal Converter	2-3
3.0 START-UP AND OPERATION	3-1
3.1 Start-Up	3-1
3.1.1 Calibration Data	3-1
3.1.2 Flow Measurement	3-2
3.2 Configuration Procedure	3-3
3.2.1 Keypad Functions	3-5
3.3 Changing Parameters	3-8
3.3.1 Program protection	3-8
3.3.2 Language	3-9
3.3.3 Meter size	3-9
3.3.4 Range unit	3-9
3.3.5 Range DN (Cal Factor/Meter Capacity)	3-9
3.3.6 Range	3-10
3.3.7 Totalizer unit	3-10
3.3.8 Pulse factor	3-12
3.3.8.1 Allowable Pulse factors	3-13
3.3.8.2 Pulse factor Summary	3-14
3.3.9 Pulse width	3-14
3.3.10 Max Alarm	3-14
3.3.11 Min Alarm	3-14
3.3.12 Low flow cut-off	3-14
3.3.13 Damping	3-15
3.3.14 Filter	3-15
3.3.15 Density	3-15
3.3.16 Flow	3-16
3.3.17 System zero adj.	3-16
3.3.18 Submenu-Operating mode	3-16
3.3.18.1 Operating mode - Standard	3-16
3.3.18.2 Operating mode - Piston pumps (pulsating flow)	3-17
3.3.18.3 Operating mode - Flowmeter	3-17
3.3.19 Submenu-Current output	3-17
3.3.20 Submenu-Data link	3-18
3.3.21 Submenu-Self check	3-19

3.3.22 Submenu-Detector e. pipe	3-23
3.3.23 Totalizer >F/<R	3-23
3.3.24 Overflow >F/<R	3-23
3.3.25 Error Log	3-24
3.3.26 Multiplex displ.	3-24
3.3.27 Load and Store Configuration Data from the External EEPROM	3-24
3.3.27.1 Store Data in the External EEPROM	3-24
3.3.27.2 Load Data from the External EEPROM	3-24
3.3.28 Software Level	3-25
3.3.29 Code number	3-25
3.4 Error Messages	3-26
4.0 FUNCTIONAL DESCRIPTION	4-1
4.1 Basic Functions	4-1
4.2 Design Features	4-1
4.2.1 Micro-processor Controlled	4-1
4.2.2 Display	4-1
4.2.3 Rangeability	4-1
4.2.4 Bi-Directional Flow	4-1
4.2.5 Flow Direction	4-2
4.2.6 Output Signals	4-2
4.2.6.1 Analog Output	4-2
4.2.6.2 Optional Outputs	4-2
4.2.6.3 Scaled Pulse	4-2
4.2.7 Data Link	4-2
4.2.7.1 ASCII	4-3
4.2.7.2 MICRO-DCI Binary	4-3
4.2.8 HART Interface	4-3
4.2.9 Optional Features on Base Board	4-4
4.2.10 Reference Voltage and Impedance	4-4
4.2.11 Power	4-5
5.0 CALIBRATION	5-1
5.1 General Discussion	5-1
5.2 Test Requirements	5-2
5.2.1 Equipment	5-2
5.2.2 Signal Simulator	5-2
5.2.3 Signal Converter Disassembly	5-3
5.2.3.1 Removing the Signal Converter from the base	5-3
5.2.3.2 Disassembly of the Signal Converter	5-3
5.3 Performance Verification	5-5
5.4 Initialization	5-6
5.5 Menu Sequence	5-7
5.6 Engineering Units	5-13
5.7 Calibration Procedure	5-14
5.7.1 Code Number	5-15
5.7.2 Maximum Velocity	5-15
5.7.2.1 Span Adjust-Forward Flow	5-15
5.7.2.2 Span Adjust - Reverse Flow	5-16
5.7.3 Zero Adjust	5-16
5.7.4 Adjust lout	5-16
5.7.4.1 Adjust lout at 100 %	5-16

5.7.4.2 Adjust lout at 20 %	5-17
5.7.5 Calibration	5-17
5.7.6 Adjustment of Integrators	5-17
5.7.7 Range DN	5-17
5.7.8 Flow Direction	5-17
5.7.9 Instrument Number	5-18
5.7.10 Mains Interrupt	5-18
5.7.11 Reset	5-18
5.7.12 Output data	5-18
5.7.13 Initialization	5-18
5.7.14 Analog Range	5-18
5.7.15 Excitation	5-19
6.0 MAINTENANCE	6-1
6.1 General Discussion	6-1
6.2 Signal Converter Disassembly	6-3
6.2.1 Removing the Signal Converter from the base	6-3
6.2.2 Disassembly of the Signal Converter	6-3
6.3 Troubleshooting	6-4
6.3.1 Procedure	6-4
6.3.2 Test Point (TP) Information	6-6
6.4 Parts List	6-9

Figure List

FIGURE 1-1. SIGNAL CONVERTER (COVERS REMOVED)	1-2
FIGURE 1-2. TERMINAL BOARD (SIGNAL CONVERTER REMOVED)	1-3
FIGURE 2-1. OUTLINE DIMENSIONS, REMOTELY MOUNTED SIGNAL CONVERTER	2-2
FIGURE 2-2. INTERCONNECTION WIRING FOR MODELS 10D1472/10D1462/10D1430/10D1418 ..	2-4
FIGURE 2-3. INTERCONNECTION WIRING FOR MODEL 10DS3111/10DS3112	2-5
FIGURE 2-4. USER CONNECTIONS TO SIGNAL CONVERTER	2-6
FIGURE 3-1. TYPICAL INSTRUMENT TAG	3-1
FIGURE 3-2. TYPICAL CALIBRATION TAG	3-1
FIGURE 3-3. 50SM DISPLAY AND KEYPAD	3-4
FIGURE 5-1. TEST WIRING USING SIGNAL SIMULATOR D55XC2000	5-4
FIGURE 5-2. CONFIGURATION AND CALIBRATION OVERVIEW	5-12
FIGURE 6-1. TERMINAL BOARD LAYOUT	6-7
FIGURE 6-2. ANALOG BOARD LAYOUT	6-8

Table List

TABLE 3-1. RANGE UNITS	3-11
TABLE 3-2. TOTALIZER UNITS	3-11

READ FIRST

This Instruction Bulletin contains the following changes from the previous version (PN24486):

- a. Figure 2-3 revised (Feb, 1997)

WARNING

All Flowmeters and/or Signal Converters being returned to Fischer & Porter for repair must be free of any hazardous materials (acids, alkalis, solvents, etc.). A Material Safety Data Sheet (MSDS) for all process liquids must accompany returned equipment. Contact F&P for authorization prior to returning equipment.

NEMA 4X, Corrosion Resistant Finish

This product is painted with a high performance epoxy paint. The corrosion protection provided by this finish is only effective if the finish is unbroken. It is the users' responsibility to "touch-up" any damage that has occurred to the finish during shipping or installation of the product. Special attention must be given to: meter flange bolting, pipe mounting of electronics, conduit entries and covers that are removed to facilitate installation or repair. For continued corrosion protection throughout the product life, it is the users' responsibility to maintain the product finish. Incidental scratches and other finish damage must be repaired and promptly re-painted with approved touch-up paint. Provide the model number and size of your product to the nearest Fischer & Porter representative to obtain the correct touch-up paint.

Design Level B of Instruction Bulletin 50SM1000 replaces Design Level A (PN24388). The software version of Design Level B is D699B101U01 A.11. The referenced data listed below has been added or revised in this manual.

1.0 Introduction

Figures 1-1 and 1-2, model number breakdown, power consumption, minimum liquid conductivity, alarms threshold.

2.0 Installation

Section 2.3.1, Figures 2-2, 2-3 and 2-4.

3.0 Start-up and Operation

Figure 3-3, Section 3.3.18.3, self check contacts, f_{out} , totalizer reset, Sections 3.3.27 and 3.3.28.

4.0 Functional Description

Sections 4.2.8, 4.2.9, 4.2.10 and 4.2.11.

5.0 Test Requirements

Figure 5-1, Sections 5.2.1 and 5.3.

6.0 Maintenance

Figures 6-1 and 6-2, and Section 6.4.

1.0 INTRODUCTION

1.1 General Description

The F&P Series 50SM1000B Microprocessor-Based Signal Converter is of modular construction and uses the latest state-of-the-art surface mount technology. This design concept provides a compact, reliable, secondary instrument intended for use with AC excited Magnetic Flowmeters. The 50SM1000B features firmware which has been developed especially for flow metering applications. This permits the respective Magnetic Flowmeter/Signal Converter combination to be easily customized using the various operating parameters.

The Signal Converter is housed in a remote mounted enclosure. A Signal Converter with the covers removed is shown in Figure 1-1 (fittings shown are for illustration purposes only).

As Signal Converter operations are microprocessor-based, the Converter has the capability to communicate via data link with other intelligent instruments such as F&P Series 53SU1000 SUPERVISOR, 53SU5000 SUPERVISOR-PC, or host computer. The Signal Converter will support either MICRO-DCI Binary or ASCII protocol, permitting up to 32 instruments to be addressed via the data link. In addition, when specified at time-of-purchase, communications can be provided over the 4-20 mA current output using HART protocol.

The Signal Converter can be configured manually by use of the keypad buttons located on the Converter (see Figure 1-1) or remotely by means of the data link. During configuration, the Converter remains on-line and data is updated continually. Zero is field adjustable as required.

Major features of the Signal Converter include:

- 1) All operating parameters are configurable, e.g., totalization units, flow rate range, calibration factor, etc. Parameter values can be changed via pushbuttons on the Converter or via serial interface.
- 2) Microprocessor-based with digital signal processing.
- 3) Communication via terminal, computer or similar smart instrument using RS 485 or RS 232-C. Compatible with F&P MICRO-DCI instruments permits integration into process control or monitoring systems.
- 4) Direct reading data display without operator calculations. Displays forward and/or reverse flow.
- 5) Automatic self-monitoring with error diagnostics.

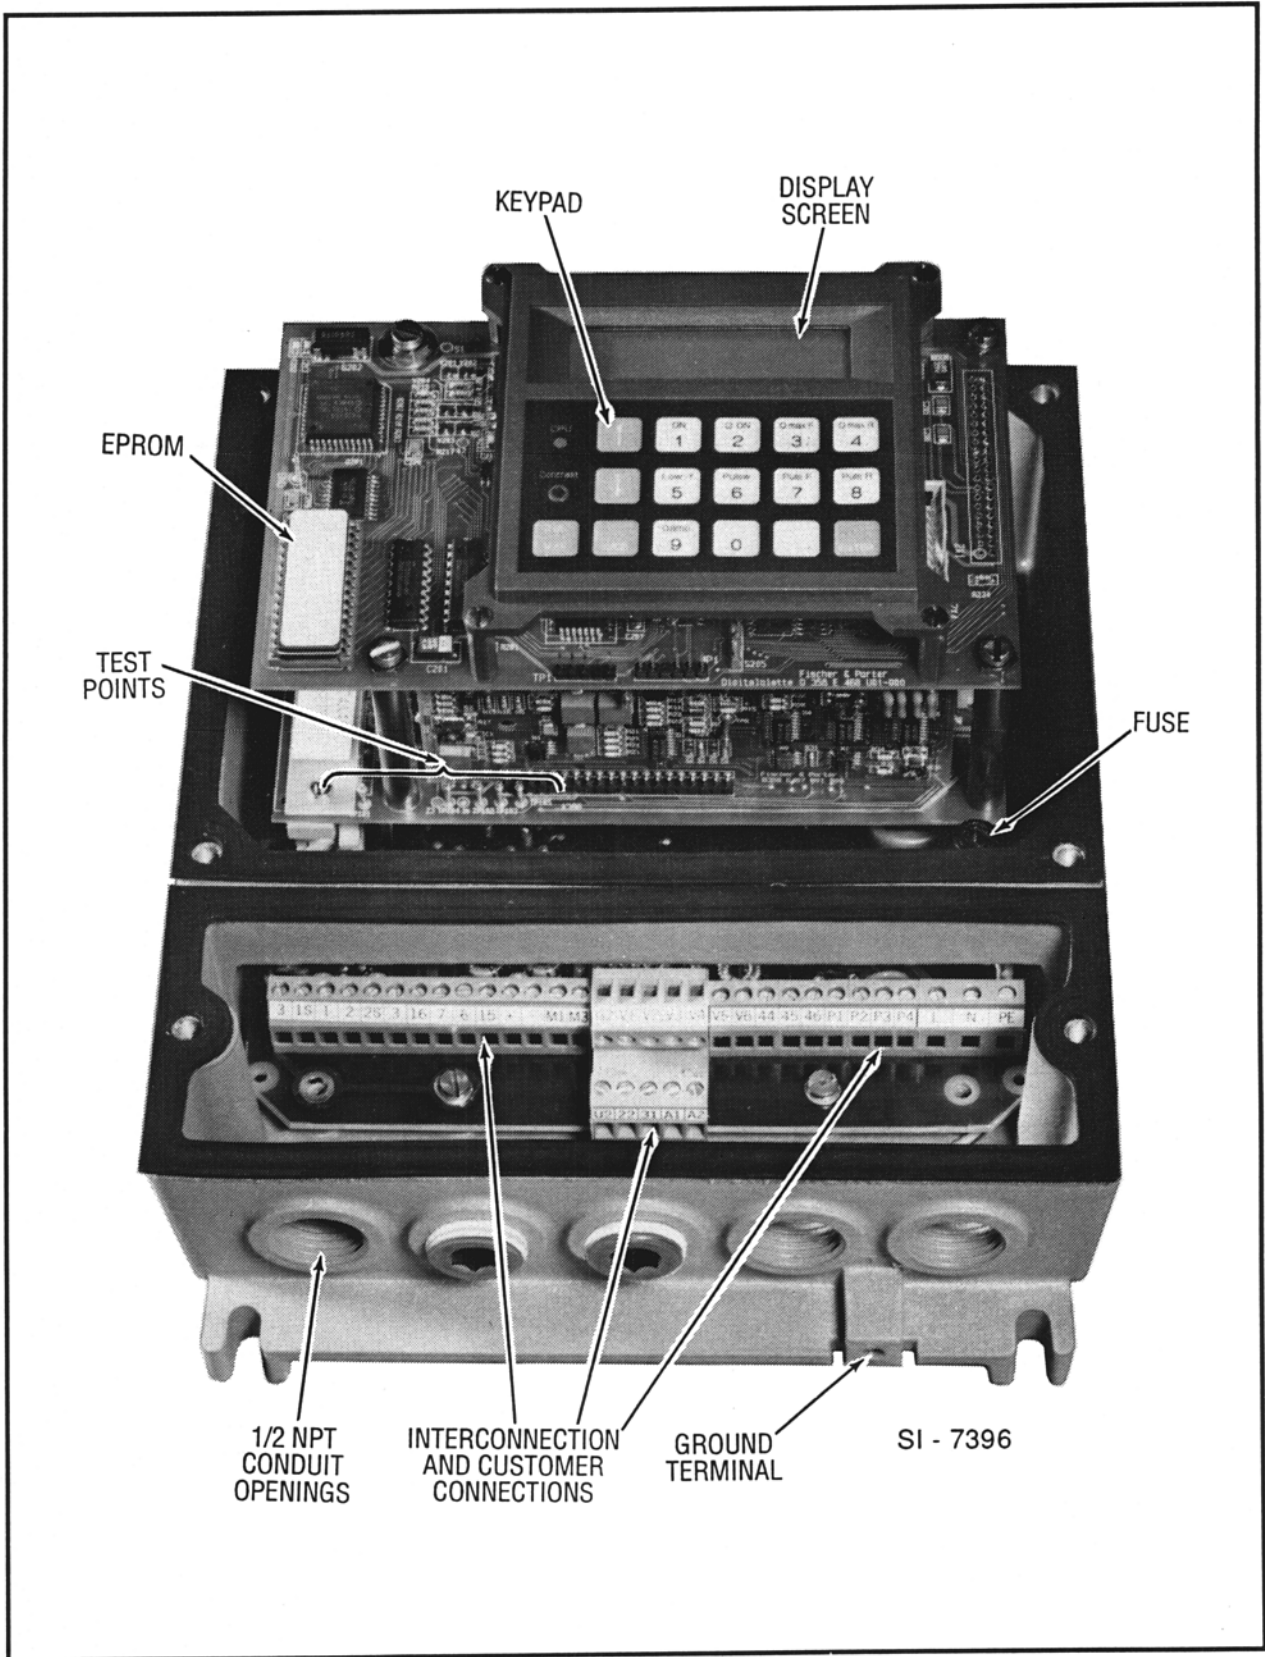


FIGURE 1-1. SIGNAL CONVERTER (COVERS REMOVED)

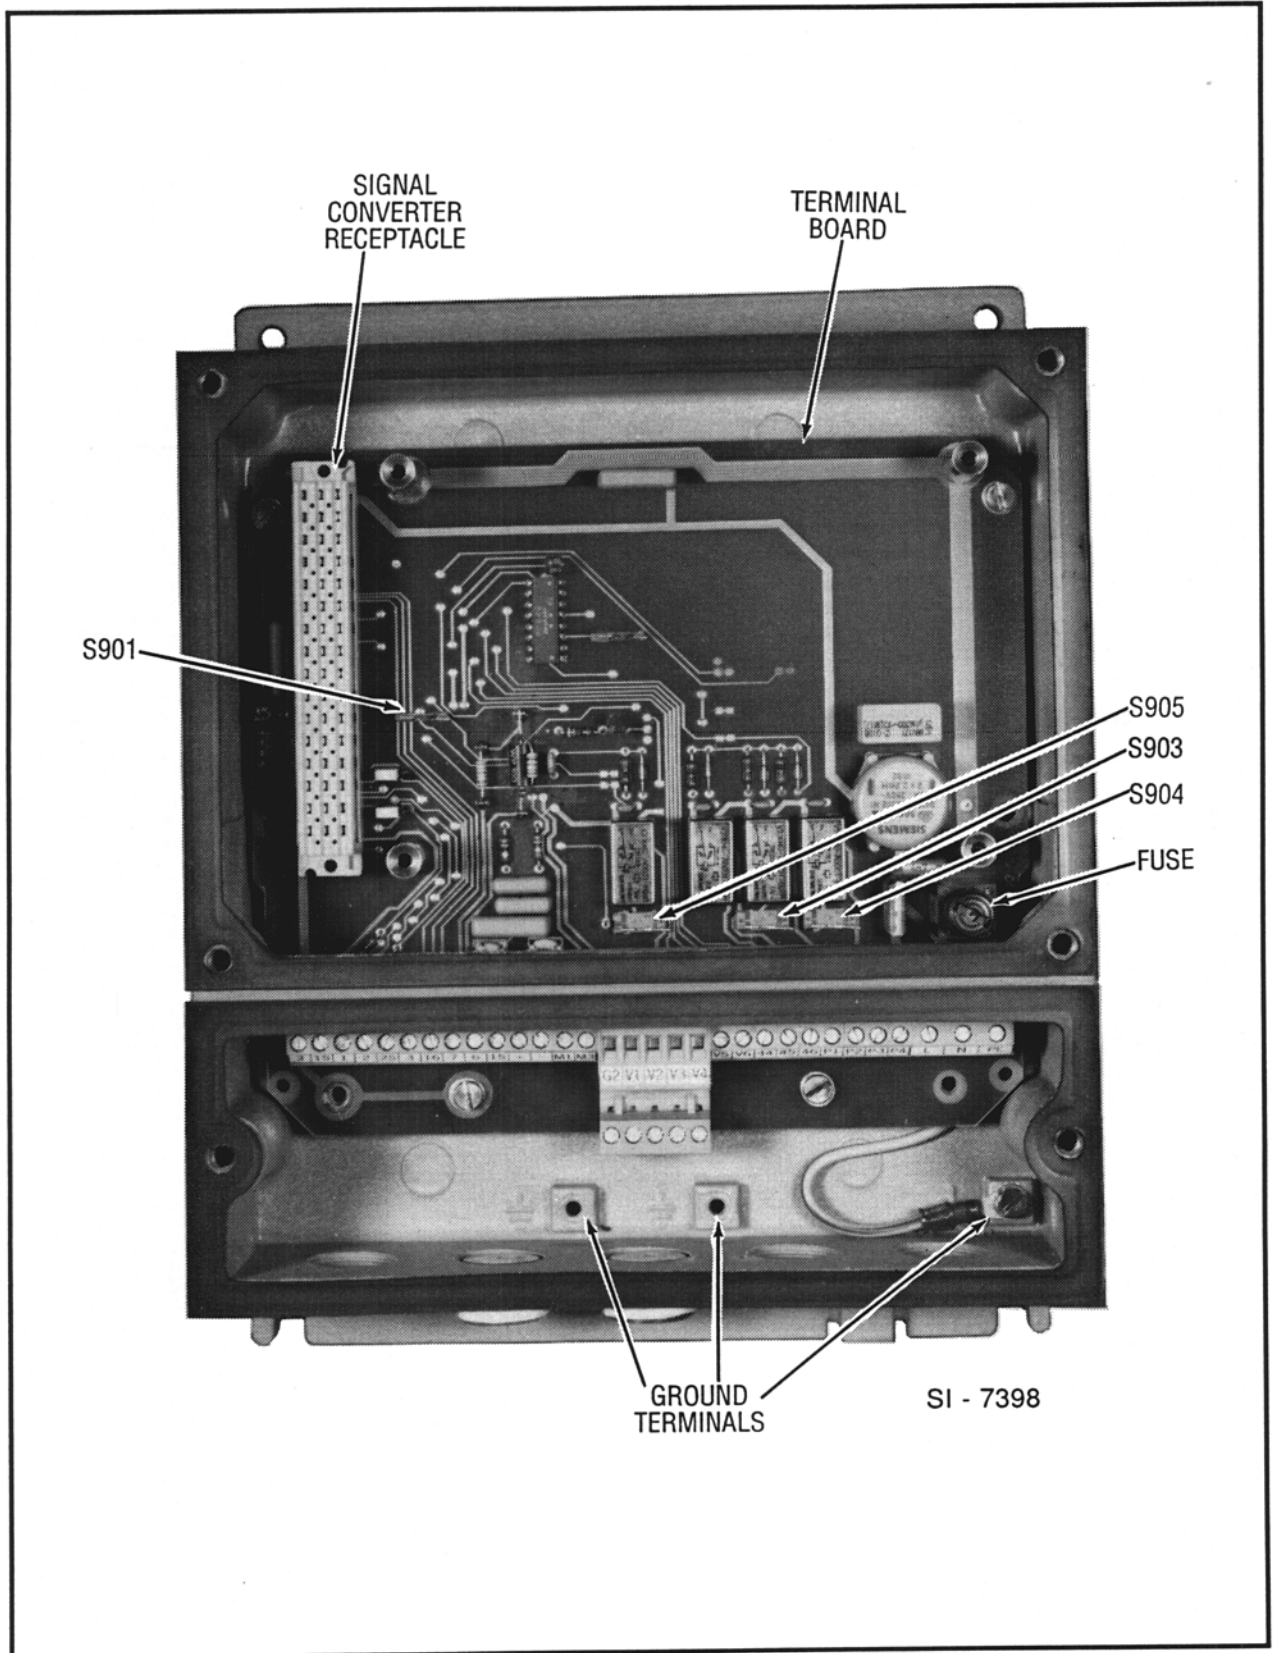


FIGURE 1-2. TERMINAL BOARD (SIGNAL CONVERTER REMOVED)

1.2 Model Number Breakdown

Refer to the F&P data sheet or the instrument tag on the Converter for the model number of the 50SM1000B Converter furnished. The details of a specific model number are defined as follows:

	50	S	M	1	0	B	X												
<u>Engineering File Reference</u>																			
Signal Converter	50																		
<u>Type of Excitation</u>																			
Sine		S																	
<u>Design Type</u>																			
Micro-processor			M																
<u>Design Designation</u>																			
Fixed Data				1															
<u>Excitation Frequency</u>																			
50 Hz					1														
60 Hz					3														
<u>Certification</u>																			
None					0														
<u>Primary</u>																			
10DS3111, 10DS3112										1									
10D1418, 10D1430 (81 ohms)										2									
10D1462, 10D1472 (1000 ohms)										3									
Other										9									
<u>Design Level</u>											B								
<u>Software Level</u>												X							
<u>Enclosure</u>																			
Remote Mounted with window, NEMA 4X and 1/2" NPT connections																			D
Other																			Z
<u>Switch Outputs</u>																			
Optocoupler																			1
Relay																			2
<u>Pulse Output/Data Link</u>																			
None																			0
Active Pulse Forward and Reverse																			1
Serial Interface RS485																			4
Serial Interface RS232																			5
<u>Contact Function</u>																			
Error Alarm																			AA
Forward/Reverse Flow Signal																			AB
Forward/Reverse Flow Signal and Two Threshold Alarms																			AC
Two Threshold Alarms																			BA

1.3. Specifications

Power Requirements

Voltage	115 V ac \pm 10% or 230 V ac \pm 10%
Line Frequency	47 - 53 Hz or 56 - 64 Hz
Power Consumption	< 30 VA (applies to the Converter only, but includes excitation current for models 10DS3111 and 10DS3112)

Performance Characteristics

Flowmeter Model Number	refer to the manufacturing specification sheet or data tag on the body of the Flowmeter
Meter Size, Cal Factor and Flow Range	refer to the Flowmeter Instruction Bulletin
Minimum Liquid Conductivity	20 μ S/cm
Bidirectional Flow	rate indication and totalization in both forward and reverse flow direction. Flow direction for analog output is indicated by contact closure.
Accuracy	1% of rate from 5% to 100% of meter Cal Factor, 0.05% of Cal Factor from 0% to 5% of Cal Factor
Response Time	1 second, minimum
Damping	configurable, 1 to 100 seconds
Current Output	0 to 20 mA, 4 to 20 mA: load resistance 0 to 500 ohms 0 to 10 mA, 2 to 10 mA: load resistance 0 to 1000 ohms

Pulse Outputs

Scaled Pulse	24 V dc, 150 ohm min load, 0-4 kHz max, pulse width configurable from 0.032 ms to 2000 ms
--------------	--

Contact Outputs

Alarm Contact	denotes failure condition, with high or low analog output. Signal levels operated via contacts must not exceed 3 VA, 28 V or 250 mA.
Flow Direction	contact transfers when flow direction changes

Alarms Threshold contact status changes when preset flow value is passed. Signal levels operated via contacts must not exceed 3 VA, 28 V or 250 mA

Contact Inputs (optional)

Zero Return or Totalizer Reset as specified by Model Number, remote contact closure needed to initiate action, as follows:
Total Reset (forward and reverse), momentary closure.
Zero return, maintained closure when pump or valve stops flow through meter

Communications

Data Link I/O binary or ASCII communications:
-- via RS 232-C, 110 to 9600 Baud, 45 feet (14 m) limit, 1 instrument serial communication;
-- via RS 485, 110 to 28.8 kBaud, 4000 feet (1220 m) limit, up to 32 instruments in parallel

HART Interface 1200 bits/s (transmitting/receiving) using frequency shift keying (FSK) as defined by Bell 202 standard, 5000 feet (1525 m) limit

Empty Pipe Detection automatically drives the analog and digital output signals to zero when the meter electrodes become uncovered

Physical Characteristics

Ambient Temperature Range (converter only) 14° F to 122° F (-10° C to 50° C)

Relative Humidity 10% to 90% (non-condensing)

Vibration Limit < .50 g (10 to 200 Hz)

Enclosure Classification NEMA 4X (IEC 529 IP65)

Housing 3-piece aluminum housing with gasketed covers, panel or wall-mounting (refer to Figure 2-1)
9.7 lbs (4.4 kg)

Cable Entrance five 1/2" NPT openings for conduit fittings in base

2.0 INSTALLATION

2.1 Inspection

The F&P Series 50SM1000 Signal Converter is shipped in a heavy-duty protective container that is specially designed to provide adequate protection of the equipment during transit. The packaging is certified for air shipment by the Container Testing Laboratory. An itemized list of all items included in the shipment is attached to the shipping container.

The equipment should be inspected immediately upon arrival for indications of damage that may have occurred during shipment. In most cases a careful visual inspection is all that is required to establish apparent damage.

All damage claims should be reported to the shipping agent. If the equipment is damaged to the extent that faulty operation may result, contact F&P before installation. Always reference the complete instrument serial number and model number in all correspondence concerning the equipment supplied.

Following inspection of the shipment contents, all items should be replaced in the shipping container for storage and/or transit to the installation site.

2.2 Location and Mounting

Ideally, the installation site for the remote mounted Signal Converter should be clean, well lighted and adequately ventilated. Also, consideration should be given to access requirements for repair and maintenance of the equipment. The remote mounted enclosure is designed to meet NEMA 4X standards and is suitable for indoor or outdoor installation in an environment that is within the temperature, humidity and vibration limits as given in the specifications in Section 1.3 . Mounting dimensions for the wall or panel mounted enclosure are provided in Figure 2-1. Mounting hardware is to be supplied by the user.

The installation site must be provided with a source of power that is compatible with the Signal Converter power requirements. Refer to the Converter instrument tag for power requirements .

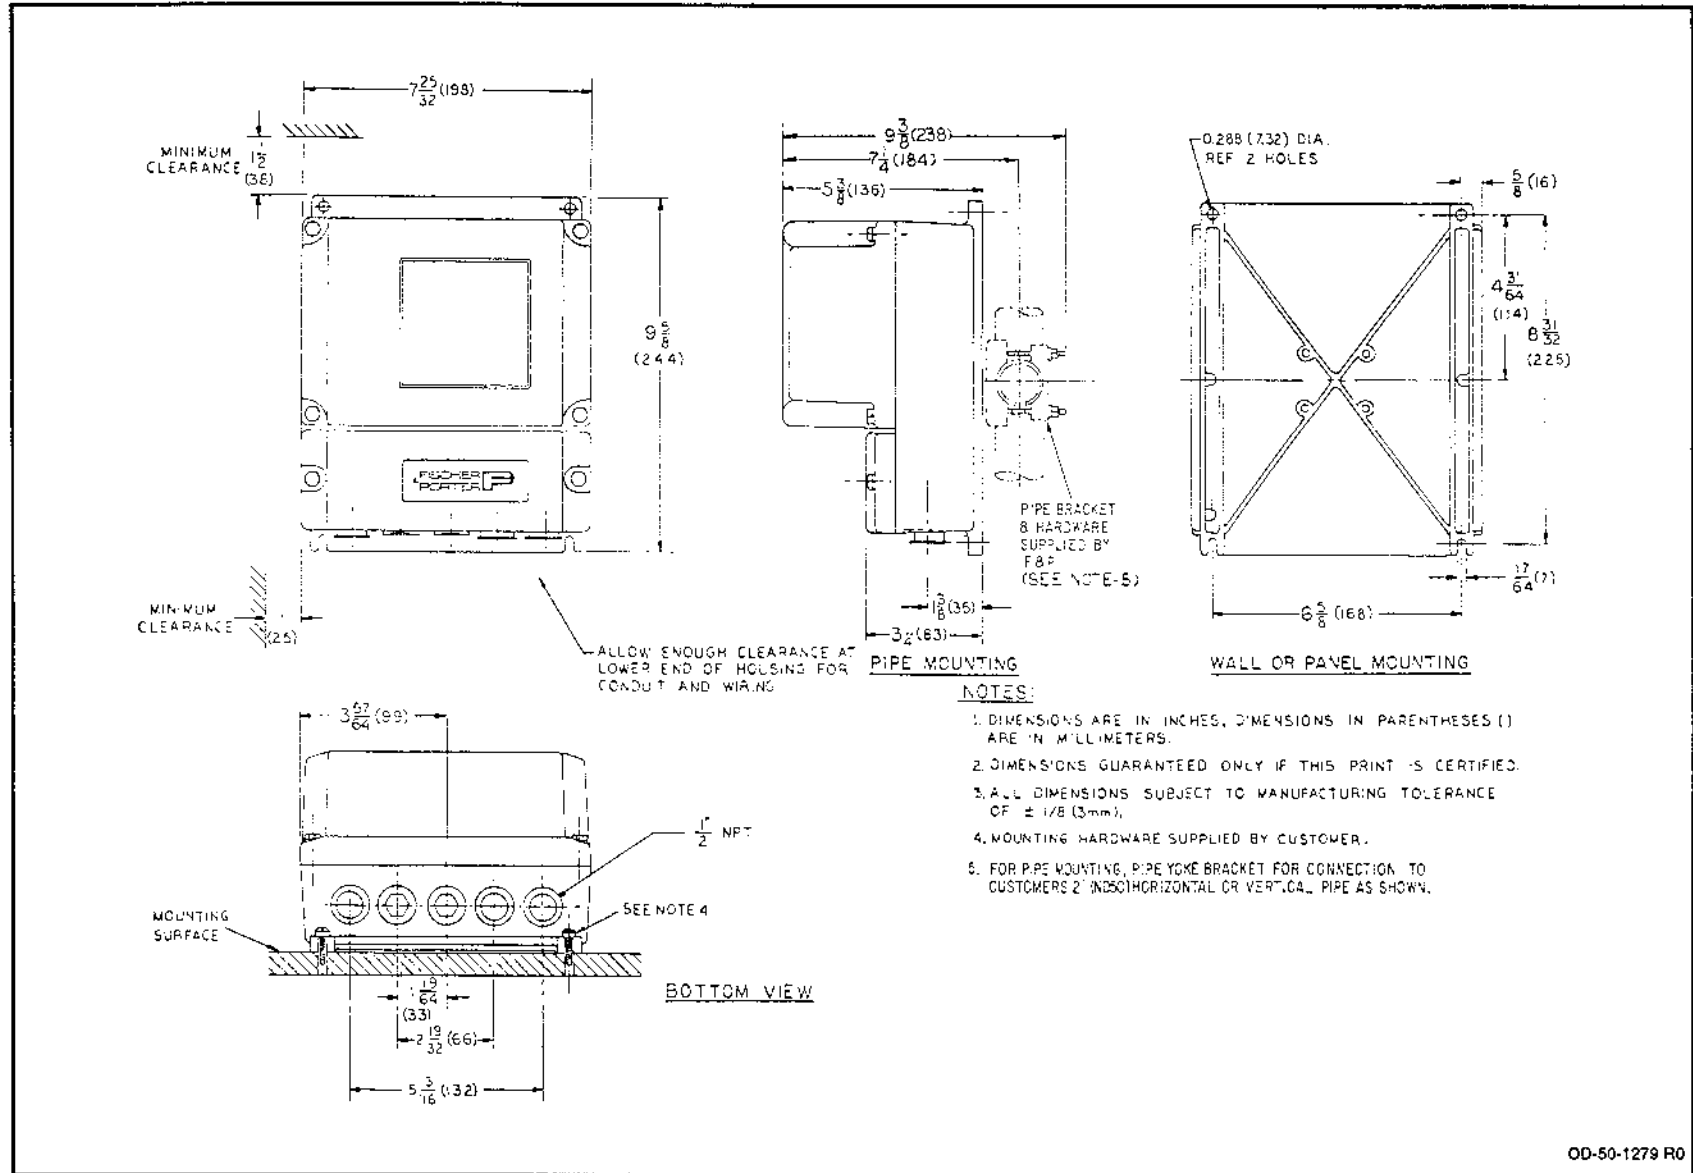


FIGURE 2-1. OUTLINE DIMENSIONS, REMOTELY MOUNTED SIGNAL CONVERTER

2.3 Electrical Interconnections

2.3.1 Remotely Mounted Signal Converter

WARNING

Equipment powered by an ac line service constitutes a potential lethal electric shock hazard. Installation and servicing of the Magnetic Flowmeter and Signal Converter should only be attempted by a qualified electronics technician. Make certain that the power input leads are disconnected from the operating circuit before attempting electrical connections.

The Signal Converter customer connection box is supplied with five 1/2" NPT openings for conduit fittings. Any unused opening(s) must be sealed by installing a 1/2" pipe plug in each unused opening. This is required to maintain the NEMA 4X rating of the enclosure. All interconnection wiring is to be enclosed within metal conduit.


The Signal Converter signal and power interconnection cables are to be terminated to the 36-point terminal block located in the Converter customer connection box (refer to Figure 1-1). Certain terminal assignments vary in accordance with the model number. Terminal assignments are defined on the interconnection diagram. Note that the terminals labeled V1 through V4 are used for the active pulse output as well as the data link. Consequently, only one of these can be selected as an option. If a pulse output is required as well as the data link, the output pulse must be optocoupled, and is available on terminals 55 and 56 (V5 and V6). When this combination is selected, the alarm contact on terminals V5 and V6 (39 and 40) is not available.

Unless otherwise specified, fifty feet of signal and ground cable is supplied by F&P for connecting the Magnetic Flowmeter process signal (1, 2 and 3), reference signal (16 and 3, or 6 and 7 with shield) and magnet coil drive (M1 and M3-shield) to the remote mounted Signal Converter. The Flowmeter housing ground terminal is connected to the Signal Converter housing ground terminal, which is connected to an external earth ground. Refer to the grounding procedure section of the Instruction Bulletin provided with the Flowmeter.

Refer to the **interconnection diagram** that is applicable to the Magnetic Flowmeter.

- Figure 2-2. Models 10D1472/10D1462/10D1430/10D1418
- Figure 2-3. Models 10DS3111/10DS3211

Refer to Figure 2-4 for **user connections** to Signal Converter.

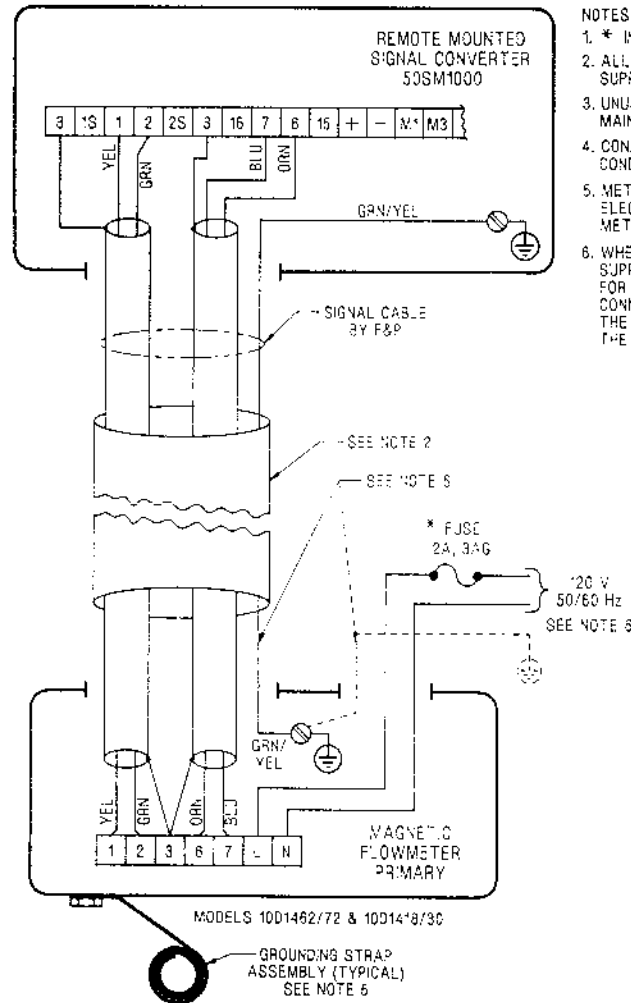


NOTES:

1. * INDICATES SUPPLIED BY CUSTOMER.
2. ALL WIRING TO BE ENCLOSED IN METAL CONDUIT SUPPLIED BY CUSTOMER
3. UNUSED CONDUIT CONNECTIONS MUST BE PLUGGED TO MAINTAIN NEMA 4 RATING
4. CONDUIT CONNECTIONS ON 10D1462/72 & *50SM1000 ARE 1/2" NPT. CONDUIT CONNECTIONS ON 10D1418/30 ARE 3/4" NPT.
5. METER GROUNDING STRAPS ARE USED TO PREVENT STRAY ELECTRICAL CURRENTS FROM PASSING THROUGH THE METERED LIQUID.
6. WHEN METER PRIMARY IS CONNECTED TO A SOURCE OF SUPPLY (~20Vac) DIFFERENT THAN THE SOURCE OF SUPPLY FOR THE 50SM1000, THE METER PRIMARY SHALL BE CONNECTED TO THE PROTECTIVE GROUND (GREEN WIRE) AT THE LOCAL SUPPLY SOURCE. THE GREEN/YELLOW LEAD FROM THE 50SM1000 SHOULD NOT BE CONNECTED AT THE PRIMARY END.

CSI - 7393-1
(ID-50-1824 -1)

FIGURE 2-2. INTERCONNECTION WIRING FOR MODELS 10D1472/10D1462/10D1430/10D1418

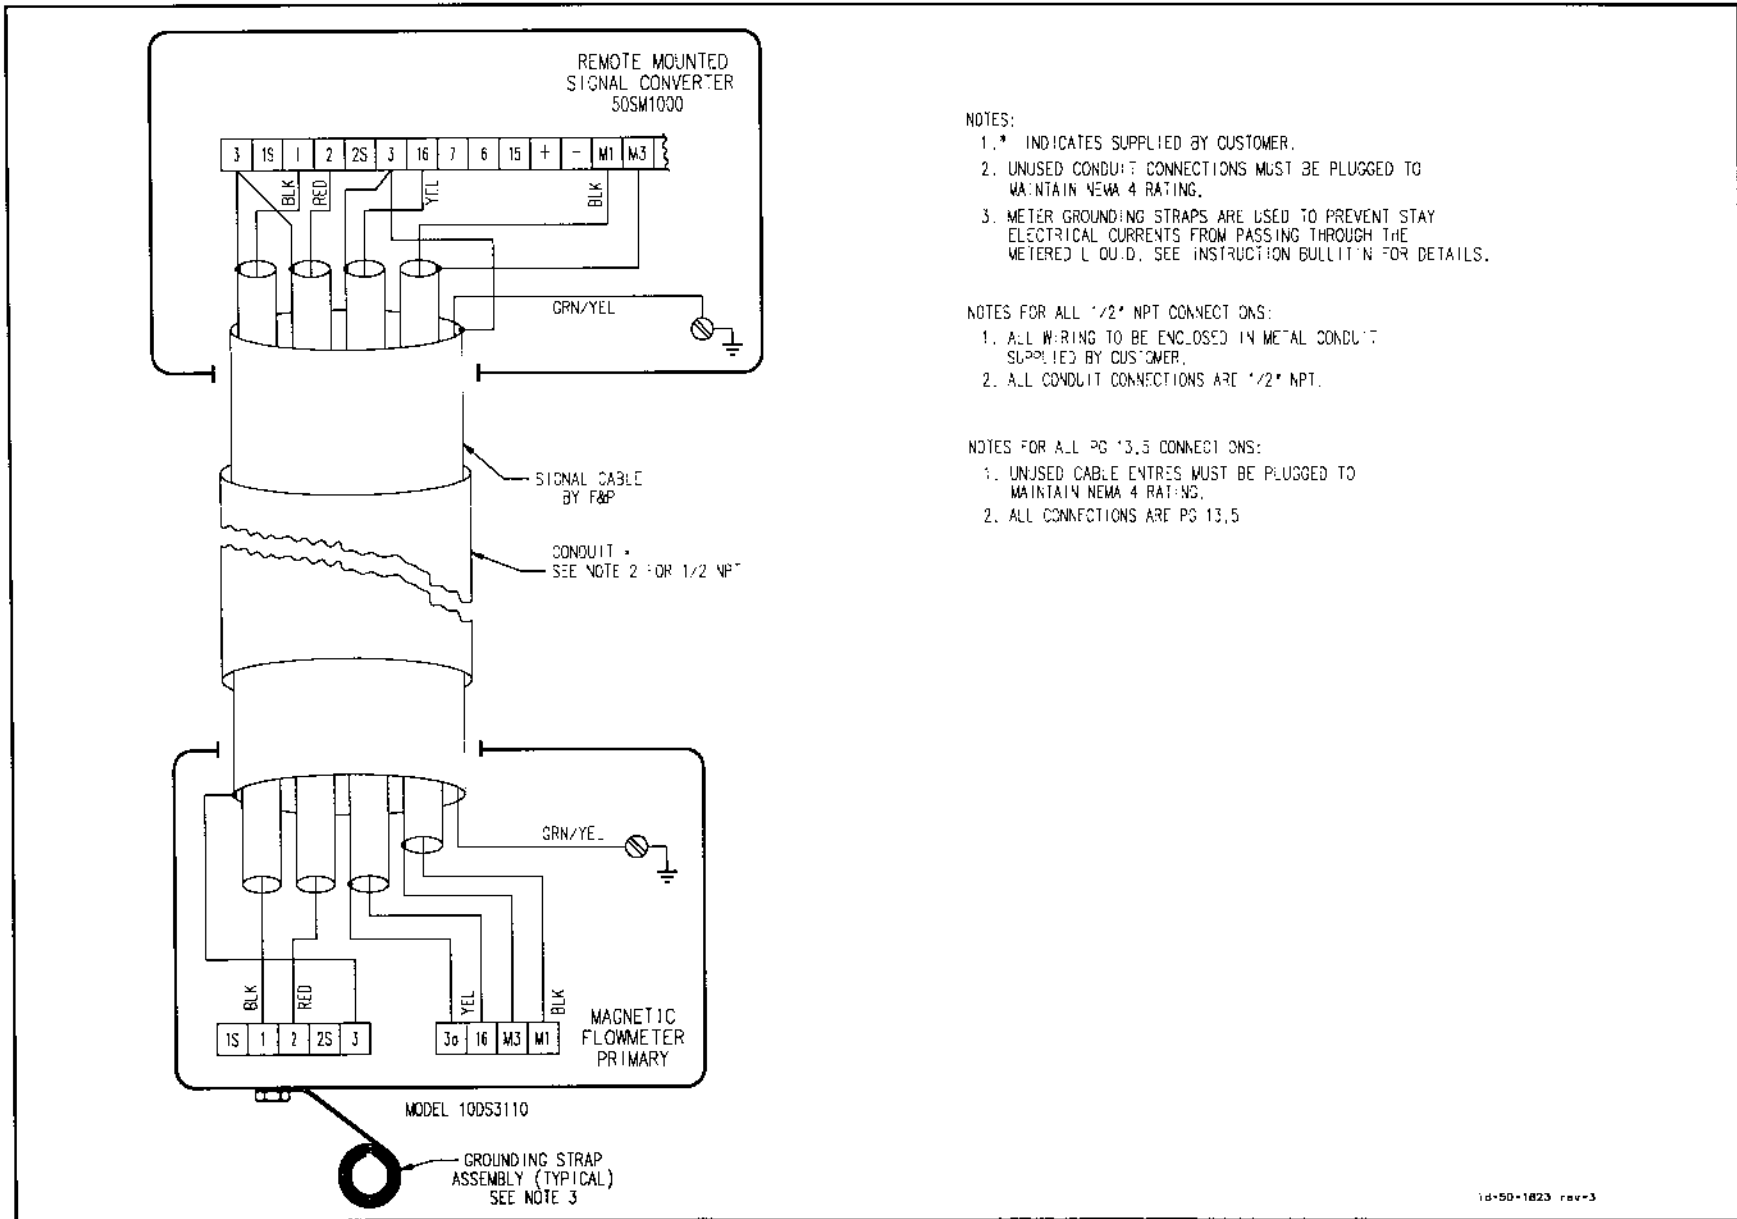

NOTES:

1. * INDICATES SUPPLIED BY CUSTOMER.
2. UNUSED CONDUIT CONNECTIONS MUST BE PLUGGED TO MAINTAIN NEMA 4 RATING.
3. METER GROUNDING STRAPS ARE USED TO PREVENT STAY ELECTRICAL CURRENTS FROM PASSING THROUGH THE METERED LIQUID. SEE INSTRUCTION BULLETIN FOR DETAILS.

NOTES FOR ALL 1/2" NPT CONNECTIONS:

1. ALL WIRING TO BE ENCLOSED IN METAL CONDUIT SUPPLIED BY CUSTOMER.
2. ALL CONDUIT CONNECTIONS ARE 1/2" NPT.

NOTES FOR ALL PG 13,5 CONNECTIONS:

1. UNUSED CABLE ENTRIES MUST BE PLUGGED TO MAINTAIN NEMA 4 RATING.
2. ALL CONNECTIONS ARE PG 13,5.

1d-50-1823 rev-3

FIGURE 2-3. INTERCONNECTION WIRING FOR MODEL 10DS3111/10DS3112

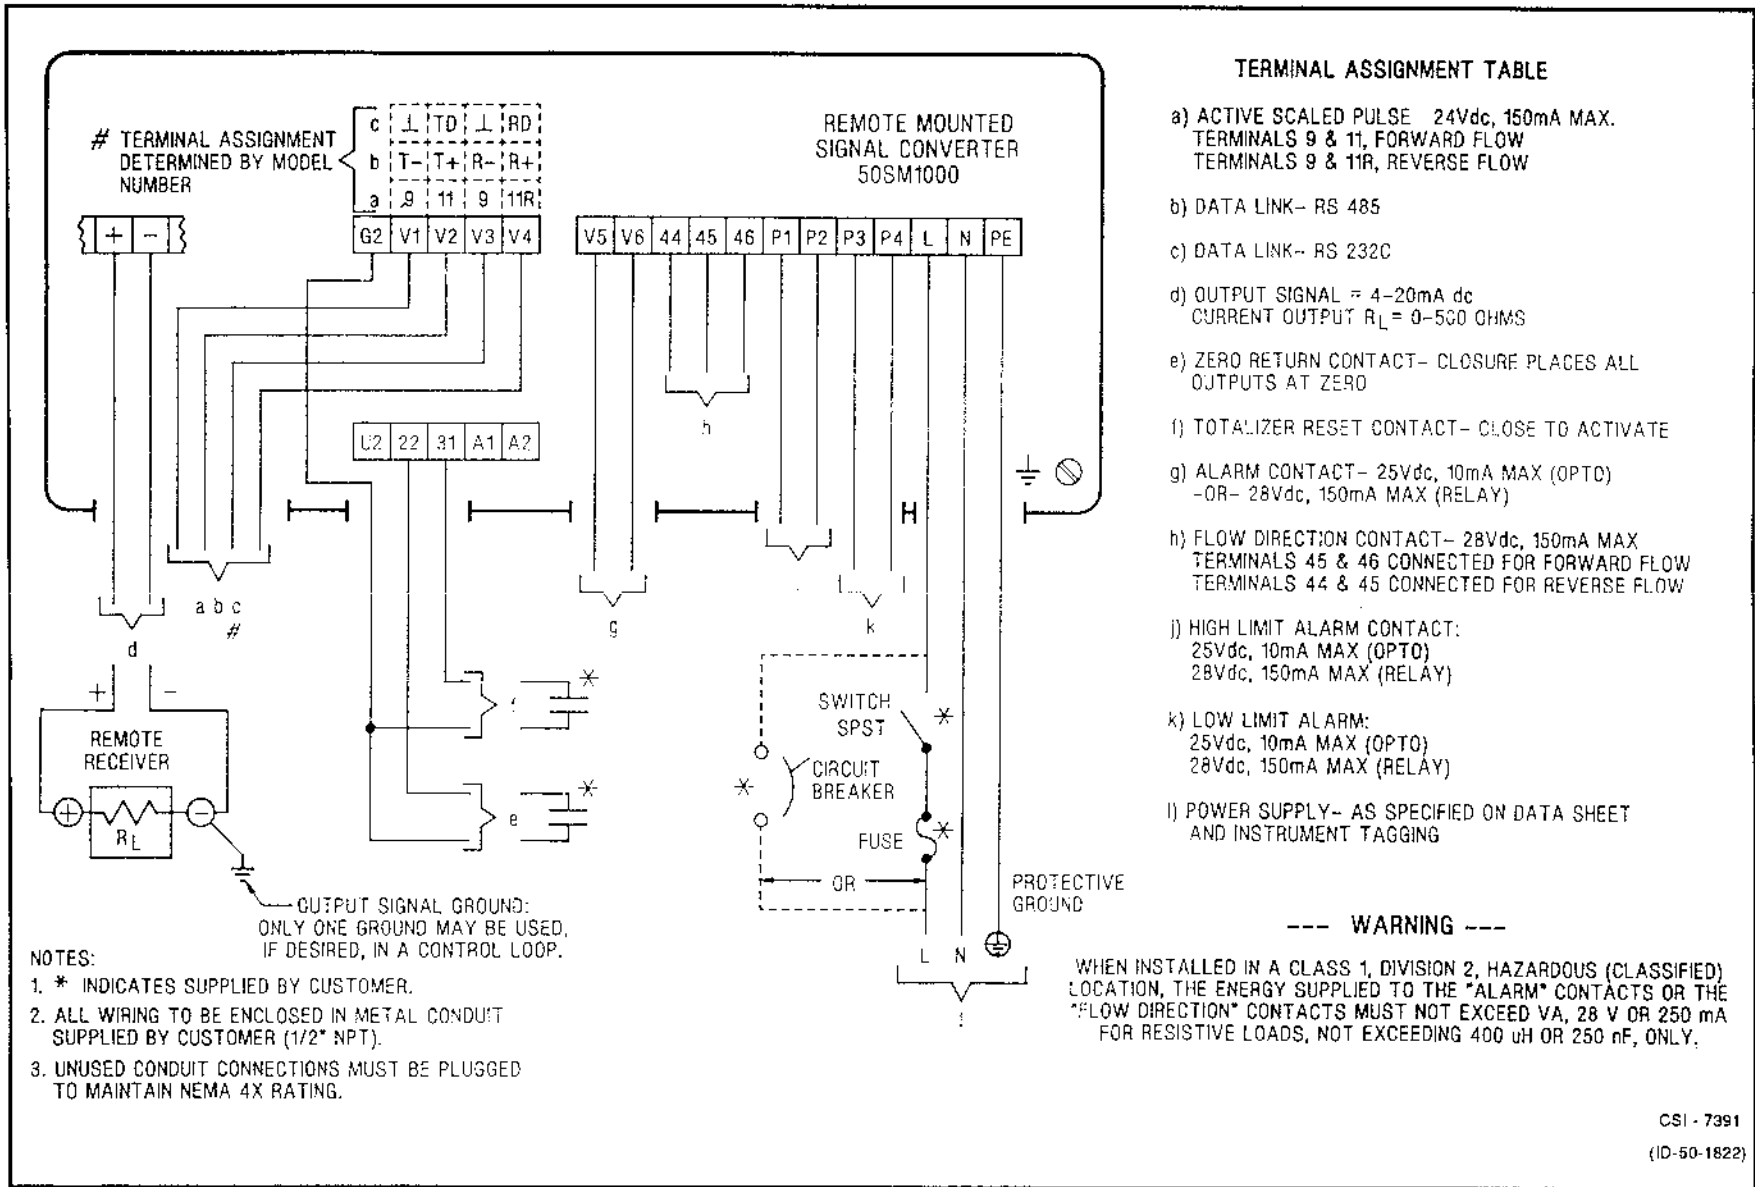



FIGURE 2-4. USER CONNECTIONS TO SIGNAL CONVERTER

3.0 START-UP AND OPERATION

3.1 Start-Up

3.1.1 Calibration Data

The Magnetic Flowmeter and its associated Model 50SM Signal Converter are a discrete flow metering system. Therefore the specific Flowmeter/Converter combination must be installed and operated as a dedicated unit. Each flow metering system is precisely calibrated at the factory in accordance with customer specified flow parameters. The data recorded at calibration is listed on the tags attached to the Signal Converter. Typical instrument and calibration tags are shown in Figures 3-1 and 3-2.

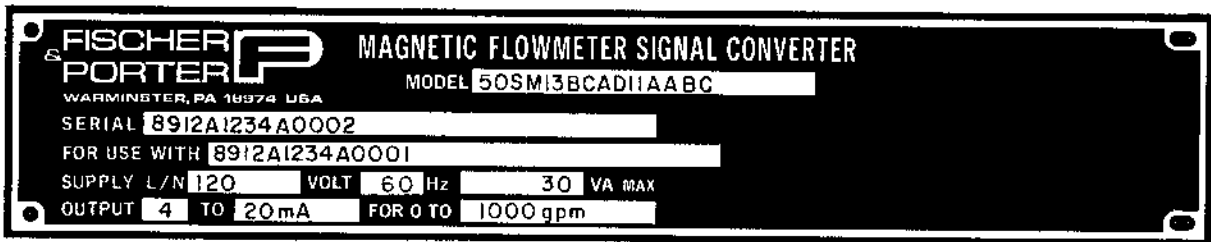

SD - 99 - 1905

FIGURE 3-1. TYPICAL INSTRUMENT TAG
(located on the Converter base)

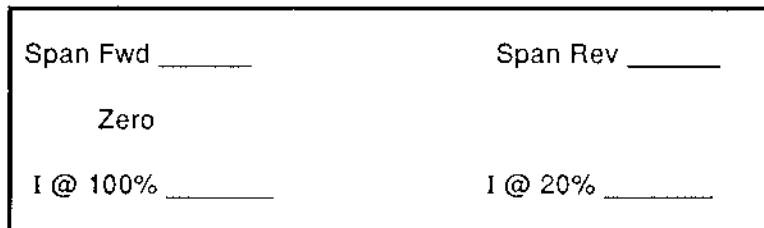


FIGURE 3-2. TYPICAL CALIBRATION TAG
(located on the Analog board)

As the flow metering system is precalibrated, it is generally ready for on-line service as received. To place the flow metering system in operation, proceed as outlined in paragraph 3.1.2.

In the event that the specified system flow parameters or engineering units are to be changed, the Signal Converter must be reconfigured to agree with the revised flow values. The procedure is outlined in paragraph 3.2.

Should it be necessary to replace the Signal Converter assembly, the operator should record the operating parameters because these values must be entered in the replacement Converter. The replacement Converter is factory calibrated, eliminating field calibration requirements. Enter the noted operating parameters and the system can be returned to service. Refer to Section 3.3.27.

3.1.2 Flow Measurement

<p style="text-align: center;">WARNING</p> <p>Equipment powered by an ac line service constitutes a potential lethal electric shock hazard. Installation and servicing of the Magnetic Flowmeter and Signal Converter should only be attempted by a qualified electronics technician. Make certain that the power input leads are disconnected from the operating circuit before attempting electrical connections.</p>

To place the flow metering system on-line, proceed as follows:

- 1) Verify that the Signal Converter has been properly mounted and that system interconnection wiring has been completed correctly, as discussed in the Installation Section. It will be necessary to remove the instrument housing covers temporarily to permit access for inspection of system wiring and to verify normal operation.
- 2) Check that the external power source connected to the Signal Converter is compatible with the power requirements of the Signal Converter. The Converter power requirements are stated on the name tag affixed to the Converter housing.
- 3) Replace Converter covers and apply power to the Signal Converter and the Magnetic Flowmeter (primary).
- 4) Using the keypad on the front of the Signal Converter, verify that system operating parameters have been correctly entered (refer to Section 3.3). This data can be verified with the Signal Converter operating in the monitor mode. Refer to the flow parameter values given on the F&P manufacturing specification sheet (identified by serial number).
- 5) Initiate a minimal flow through the process pipeline for several minutes to purge entrapped air from the piping system. Flow rate indication should be displayed on the Signal Converter readout concurrent with flow start-up. Accurate measurement cannot be expected until all air has been purged from the process pipeline. After the pipeline has been purged of air, the flow totalizer can be reset to zero as described in Section 3.3.17.
- 6) When system operation appears normal, initiate a full pipe-no flow condition and perform an automatic zero adjustment.
- 7) Replace all housing covers. Log the flow total displayed on the LCD readout or reset flow totalizers. Process measurement will commence with the initiation of flow through the meter.

3.2 Configuration Procedure

The unit has been pre-configured at the factory per the specifications given at the time the order was placed. However, before or after the Converter is connected to a Magnetic Flowmeter, any of these specifications can easily be changed using the procedure described in this section. Note that the software version described is A.11 (used with ASCII or binary communications). Other versions may show slightly different displays and options.

NOTE

Additional configuration information and a typical Test Wiring Diagram are provided in Section 5.0.

All data base interrogations and changes are made using the keypad on the front of the Converter. To gain access to the data base, it is necessary to leave the normal "monitoring mode" and enter the "configuration mode". This is accomplished by pressing the enter button on the keypad. The various parameters of the data base can then be viewed by moving up or down through the menu by pressing one of the two arrow keys. If no entries or changes are made within 20 seconds the unit will automatically revert to the monitoring mode.

When changing the numeric value of a parameter, select the parameter. The top line of the display will show the parameter name, press enter and the bottom line will show the cursor.

Enter the required value using the numeric keys, press the enter key and the value will be entered into memory. It will then be evaluated by the computer, and if it is not compatible with other selected parameters it will be rejected. An ERROR message will appear if the entry is not acceptable.

Figure 3-3 shows the Converter with the covers removed.

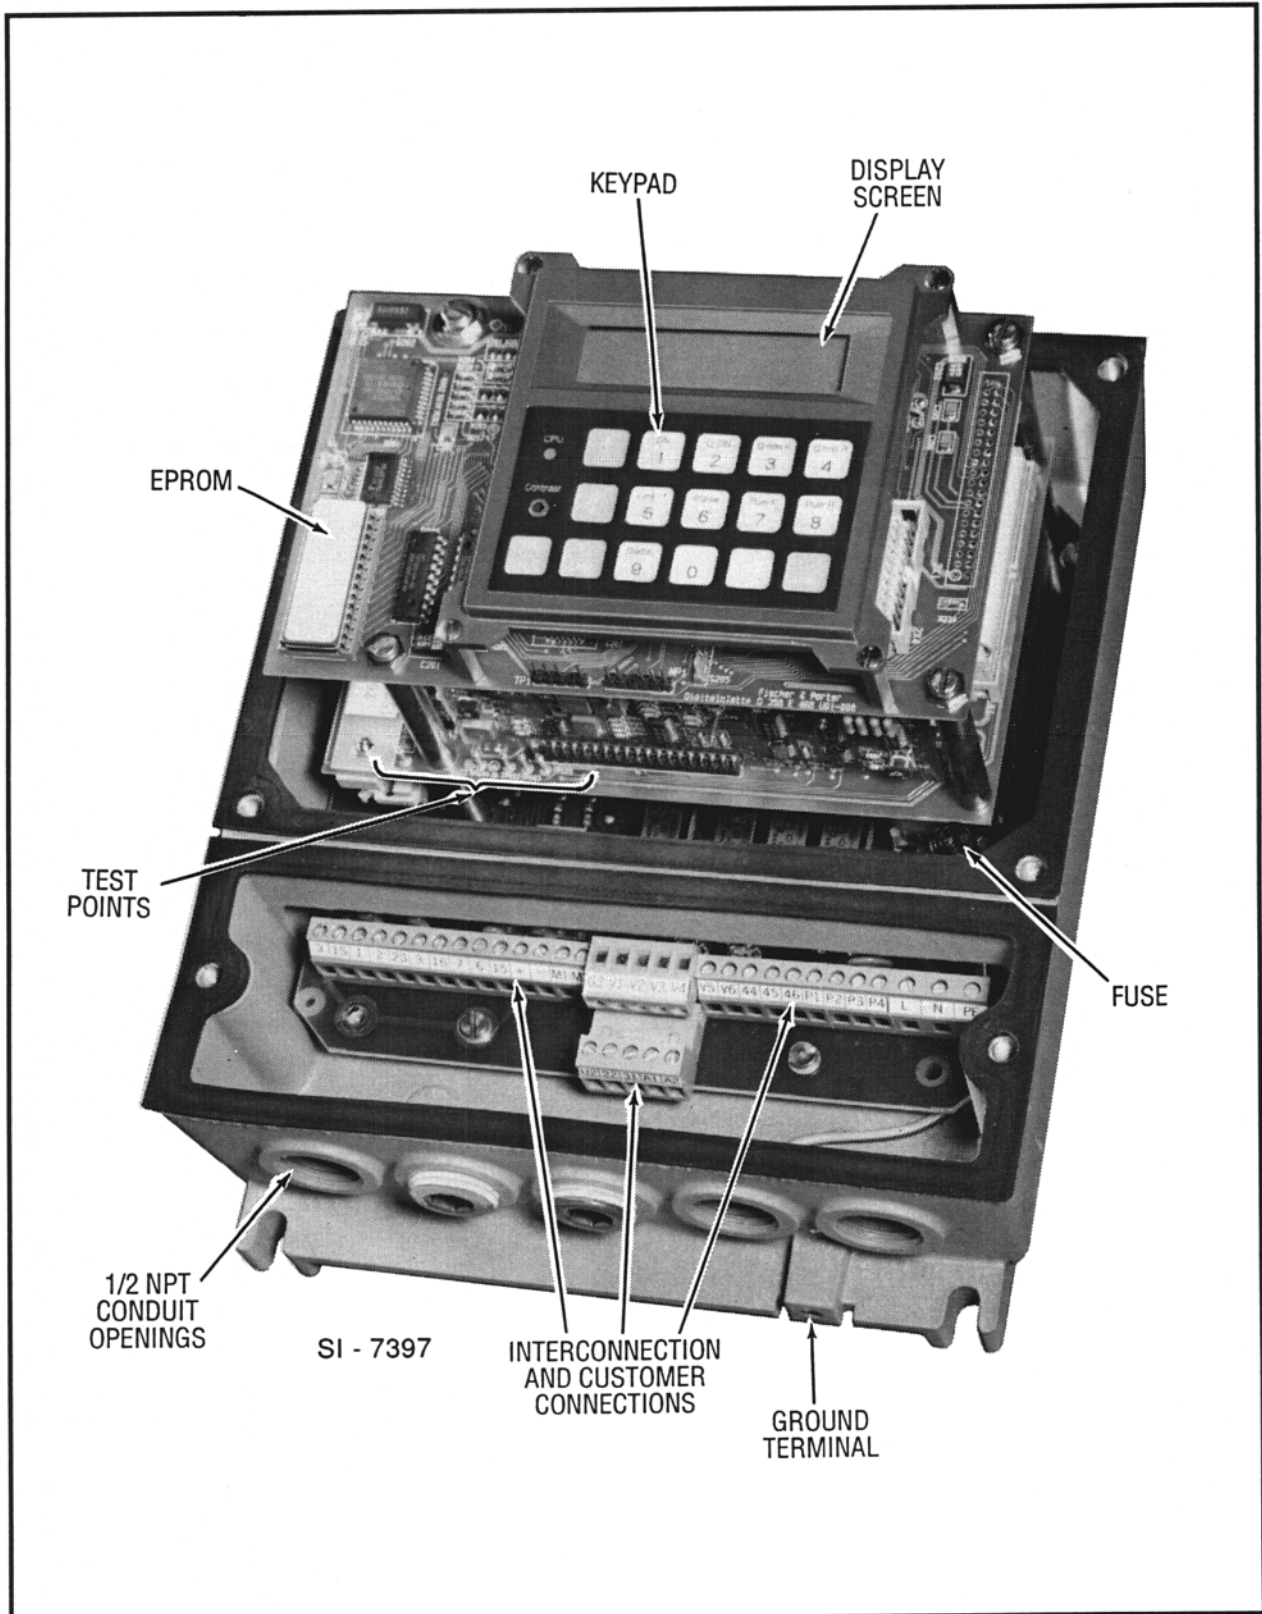


FIGURE 3-3. 50SM DISPLAY AND KEYPAD

3.2.1 Keypad Functions

The keys on the keypad may have one or more functions as indicated below. The keys with the parameter codes allow direct access to that parameter without paging through the menu. It is also expedient to use the parameter keys to shorten the path to another parameter, e.g., to get to the Filter parameter, press Damping and toggle up one parameter.

When selecting a parameter, press the appropriate key. When entering a numerical value, press ENTER and select the value to be entered.

DN 1

- a) DN = meter size
- b) number 1

Q DN 2

- a) Q DN = Range DN
- b) number 2

Qmax F 3

- a) Qmax F = Range F
- b) number 3

Qmax R 4

- a) Qmax R = Range R
- b) number 4

Low.-F 5

- a) Low.-f = Low Flow Cut-off
- b) number 5

Pulsw. 6

- a) Pulsw. = Pulse width
- b) number 6

Puls F 7

- a) PulsF = Pulse factor forward
- b) number 7

Puls R
8

- a) PulsR = Pulse factor reverse
- b) number 8

Damp.
9

- a) Damp. = Damping
- b) number 9

0

- a) Load data from ext. EEPROM
- b) number 0

.

- a) Store data in ext. EEPROM
- b) decimal point

ENTER

- a) Existing data can be changed
- b) New data can be entered

C/CE

- a) Delete an incorrect data entry
- b) Exit a submenu level
- c) Select TOT>F reset (if not in a) or b) mode)

TOT.
+/-

- a) Display totalizer information in forward and reverse

↑

↓

- a) Allows paging through menus in either direction

Contrast: Display contrast can be adjusted by inserting a small screw driver in the Contrast port to the left of the keypad (refer to Figure 3-3) and turning the screw driver.

CPU: If the Central Processing Unit (CPU) fails, the LED to the left of the keypad will start flashing (refer to Figure 3-3). Contact F&P for additional information.

3.3 Changing Parameters

The following section is devoted to the configuration procedure for each changeable parameter. Some items cannot be changed even though they appear in the menu. They are "locked out" and are indicated by a series of asterisks on the second line of the display. These will be pointed out in the following discussion. Each parameter will be discussed briefly to promote an understanding of that function as well as the procedure for its configuration. The following parameters are presented in the order in which they appear on the Converter display. It is important to make changes to the parameters in the order in which they are presented up to Section 3.3.16. Refer to Figure 5-2 for an overview of the order in which the parameters are presented.

NOTE

Error code definitions are found in Section 3.4.

There are two ways to make changes to the data base. One is by entering numeric values, and the other is by making a selection from the menu. Numeric values are entered by pressing the numeric keys on the keypad.

NOTE

After approximately 20 seconds, the display will automatically return to the monitoring mode. Pressing the C/CE button will return the display to the monitoring mode.

3.3.1 Program protection

Program protection is a feature that allows the unit to be placed in the Configuration Mode so that all the parameters in the data base can be seen but cannot be changed. This protection is automatically enabled each time power is applied to the Converter. The following message will appear in the display the first time an arrow button is pressed after power has been applied.

Prog. protection
on

To remove the PROGRAM PROTECTION simply press the enter key, and the message in the display will be changed to the following.

Prog. protection
off

It is now possible to step through the data base and make changes to it. It should be noted that if Prog. Protection is "on" and an attempt is made to change a parameter listed in the menu, the display will indicate:

* ERROR *
PROG. PROTECTION

3.3.2 Language

Messages and data can be shown in the display in nine different languages (depending on software). Changing languages affects only the text that appears in the display. It does not affect any of the stored values. The languages are selected by pressing the arrow key to step through the menu. Press enter when the preferred language appears.

```

Language
English
    
```

3.3.3 Meter size

The meter size function is locked out, and a message will be displayed as shown below. The cal factor or meter capacity stamped on the meter nameplate must be entered in the Range DN parameter.

```

Meter size
*****
    
```

3.3.4 Range unit

There is a table of flow units in the EPROM from which the range units can be selected. A listing of available units is given in Table 3-1. Each unit is normally available in seconds, minutes, or hours. For example, L/s, L/min, or L/h. US gallons are available in minutes, hours, or in million gallons per day. Units are added or deleted periodically as software is updated.

```

Range unit
gpm _
    
```

To select the range unit from this menu, first enter the configuration mode by pressing the arrow button. Next, press one of the arrow keys to move through the data base until Range unit appears on the top line of the display, and then press the enter key. Use the arrow keys to go through the Unit Menu until the desired unit appears on the bottom line of the display. Press the enter key again and the selected unit is placed in memory. No further action is required.

3.3.5 Range DN (Cal Factor/Meter Capacity)

Each magnetic flowmeter is calibrated to determine its flow capacity at a given velocity, which has been established by F&P at 33.33 ft/s for the Cal Factor and 10 m/s (32.808 ft/s) for the Meter Capacity.

This capacity is expressed in units such as gpm, l/m, or mgd and is called the calibration factor. Calibration factors (Cal Factor/Meter Capacity) are recorded on the Magnetic Flowmeter nameplate. Some meters may have a meter factor recorded instead of the calibration factor. Meter factors can be converted to calibration factors in gpm by using the following equation:

$$\text{Cal Factor} = (\text{Meter Factor})^2 \times 81.6$$

The calibration factor is the base upon which the converter establishes maximum and minimum limits for range settings and outputs. A typical calibration factor for a two inch magnetic flowmeter is 268.4 gpm. It will appear in the display as shown below.

Cal-fact 268.400 gpm

If the units (gpm) are not the desired units step back to RANGE UNITS and change to the correct value. To enter a calibration factor, press the enter key. The number 268.400 will disappear and will be replaced by the cursor. The unit "gpm" will remain. Enter the cal factor value, as it appears on the Magnetic Flowmeter nameplate, and press the enter key. The new calibration factor will be entered into memory. This value will also be entered into the range setting. The Pulse factor will be set to one pulse per engineering unit.

3.3.6 Range

Entering the cal factor automatically sets both the forward and reverse ranges equal to that value. Note that this is the flow value at 33.33 ft/s (higher than what normal flows are in practical applications). Consequently, the range must be set to the actual maximum flowrate for the application. If the unit is set for unidirectional flow the reverse flow will be locked out with asterisks as discussed previously in Meter Size.

Step through the menu until Range appears in the display. For the cal factor setting of 268.4 gpm, it should look like the following display.

Range 268.400 gpm

The actual range can now be set in the same manner as the cal factor. Any value can be set between 5% and 100% of the cal factor. If a higher or lower setting is attempted an error message will appear in the display, and the new value will be rejected. For example, 12 gpm is below 5% of 268.4 gpm. If an attempt is made to enter 12 gpm as the range setting the following message will appear in the display.

Error - 11 < 0.05 Range DN

Range DN is the Cal Factor. The Cal Factor times 0.05 is 5% of that value. The message says that the value we attempted to enter is below 5% of the Cal Factor, and it will not be accepted.

There is an additional error message related to range settings. That message is FLOW> 130%, and it appears when the actual process flow exceeds the maximum range setting by 130% for any reason. This could happen because the range was set too low for the actual flow or because a valve failed or was improperly positioned. The message would appear as shown below. Between 100% and 130%, the output signal will accurately reflect the flow rate.

Flow > 130% > F 6359284 gal

3.3.7 Totalizer unit

The totalizer units available are the same as those for the range units, except they do not include units of time. A listing of available units is provided in Table 3-2. Selecting the totalizer units is done by following the same procedure as for selecting the Range Units.

TABLE 3-1. RANGE UNITS

l/s
 l/min
 l/h
 hl/s
 hl/min
 hl/h
 m³/s
 m³/min
 m³/h
 igps
 igpm
 igph
 mgd
 gpm
 gph
 bbl/s (bbl = 31 gallons)
 bbl/min
 bbl/h
 bls/day (bls = 42 gallons)
 bls/min
 bls/h
 kg/s
 kg/min
 kg/h
 t/s (metric ton = 1000 kg)
 t/min
 t/h
 gram/s
 gram/m
 gram/h
 ml/s
 ml/min
 ml/h

TABLE 3-2. TOTALIZER UNITS

l (liters)
 hl (hectoliter)
 m³ (cubic meter)
 igal (imperial gallon)
 gal (US gallon)
 mgal (million US gallons)
 bbl (barrels = 31 gallons)
 bls (barrels = 42 gallons)
 kg (kilogram)
 t (metric ton = 1000 kg)
 gram (gram)
 ml (milliliter)

3.3.8 Pulse factor

CAUTION

The sequence in which the range and pulse factor are selected is important. The range must be selected first and then the pulse factor. If the pulse factor is selected first or is not reset when a range change is made, the frequency to the totalizer could exceed the limits discussed below.

The pulse factor is used to select the number of pulses per engineering unit for totalization purposes. It functions whether or not the pulse output option is selected and operates equally on the internal and the external totalizer. If the unit is set for unidirectional flow the pulse factor in the reverse direction will be locked out. As an example, note what happens as the number of pulses per gallon is changed. Call up Pulse factor, and the display might look like the figure below.

Pulse factor
1.00000 / gal

The internal totalizer display is always direct reading so that at one pulse per gallon the totalizer will add one count for each pulse applied to it. We can select a factor of ten pulses per gallon and there will be ten pulses arriving at the totalizer for each gallon. Keep in mind that these units can be gallons, barrels, liters or whatever is selected from the units menu. Each pulse now represents 1/10 of a gallon. The totalizer will still add a count for each arriving pulse, but a decimal will be added so that the display reads in gallons and tenths of a gallon.

If we select 100 pulses per gallon then each pulse represents 1/100 of a gallon, and the decimal will appear at the proper point to show totals in hundredths of a gallon. See below for units of 1/10 gallon.

> F 45.75%
> F 34864.8 gal

NOTE

This is a seven digit counter, and as it fills up, the decimal will be continually moved to the right until it is only possible to display whole numbers.

Although selecting multiple pulses per engineering unit is practical for low flows, it creates readability problems at high flows. The higher flows could cause the totalizer to add counts so rapidly that the last digit or two would be unreadable. What is needed to slow down the totalizer is for each pulse arriving at the counter to represent more than one gallon. For example, at one pulse per ten gallons (select factor 0.1) the totalizer will receive a pulse every ten gallons, and the last digit on the right will always be a zero. The count will change every ten gallons (10,20,30, etc.). For one pulse equal to 100 gallons, (select factor 0.01), the last two digits will be zeroes, and the totalizer will change every 100 gallons.

3.3.8.1 Allowable Pulse factors

Pulse factors can be selected for any value between 0.001 to 1000. Which factor to select is generally determined by the application requirements. However, there are two restrictions that must be considered.

First, the maximum pulse output frequency at 100% of the Converter span is 4 kHz. The internal counter operates at this frequency independent of the pulse width selection for the external readout device. The following discussion applies to the internal counter as well as to an external high frequency counter. The suggested maximum count to these devices is limited to 4,000 pulses per second. Consider a max flow of 240,000 gpm (4,000 gal/s). With this flow, the highest pulse factor that could be used would be one pulse per gallon.

$$4,000 \text{ gal/s} \times 1 \text{ pulse/gal} = 4,000 \text{ pulse/s}$$

However, the Converter will normally function properly up to 130% of the range setting. This means that for a range setting of 4,000 gal/s (and 4000 pulses/s at 100%) a proper output signal will be generated for flows up to 5,200 gal/s (4,000 X 1.3 = 5,200). The analog value at 130% of the range setting will be 24.8 mA dc. Although this condition is acceptable, it is not considered good practice.

Ideally, a pulse factor should be selected to keep the pulses to the counter within the 4,000 per second limit. For example, if we apply a pulse factor of 0.1 to the above example then each pulse will represent 10 gallons, and the pulses at the counter will be within 4,000 per second.

$$4,000 \text{ gal/s} \times 1.3 \times 0.1 \text{ pulse/gal} = 520 \text{ pulses/s}$$

Second, electromechanical counters typically require a pulse width of 30 milliseconds or more and are limited to about 15 counts (pulses) per second. They require time between pulses to complete the mechanical operation of moving a wheel to its next count position. If there is not sufficient time between pulses to do this the counter will jam. A high pulse factor could create a condition where an external electromechanical counter would jam while the internal counter would continue to operate. Because the ERROR message is based upon 4 kHz (operating frequency of internal counter), there would be no alert signal to this condition.

A conservative approach would assume a 50 millisecond on time and 50 milliseconds between pulses at maximum flow. This gives us 100 milliseconds total time for each pulse or ten pulses per second. Consider a flow of 750 gpm or 12.5 gal/s.

$$12.5 \text{ gal/s} \times 1 \text{ pulse/gal} = 12.5 \text{ pulses/s}$$

But remember the converter can operate up to 130% of range setting!

$$12.5 \text{ gal/s} \times 1.3 \times 1 \text{ pulse/sec} = 16.25 \text{ pulses/s}$$

This condition would not generate an ERROR message, but it could cause the electromechanical counter to jam. It would operate normally up to the maximum range setting, and as the flow approached 130% of the range setting, the counter could jam. The internal counter would continue to count.

3.3.8.2 Pulse factor Summary

The important thing to remember about pulse factor selection is that the high frequency output is limited to 4,000 counts per second and the electromechanical devices are limited to about 15 counts per second. Also, remember that the internal counter operates independently of the pulse width selection and the external counter.

To select a pulse factor, convert flowrate to units per second. Then multiply by 1.3 to determine flowrate at 130% of range setting. This cannot exceed 5200 per second for high frequency devices or 15 counts per second for electromechanical counters. Select a pulse factor that will keep the counts within these limits.

3.3.9 Pulse width

If the pulse output option is selected the output pulse width can be adjusted between 0.032 and 2000 milliseconds. For driving an electromechanical counter, the pulse width should be about 50 milliseconds. For high speed electronic devices, a pulse width of about 50 microseconds (0.050 milliseconds) is typical.

Step through the menu until Pulse width appears in the display. The present pulse width will be displayed. Press the enter key, and the value will be replaced by the cursor which will be at the left of the display. All values are in milliseconds. To enter a microsecond pulse width, place a decimal point three places to the left of the numerical value. For example, a 50 microsecond pulse width would be entered as 0.050 milliseconds, as follows:

Pulse width 0.0500 ms

3.3.10 Max Alarm

Max alarm can be set between 0 - 130%. If the flow rate exceeds the alarm setting, a message will appear on the display. An optional high alarm contact is available at terminals P1 and P2. The percentage of range required to activate the alarm is entered in this parameter. When the flow exceeds the entered value, a flashing upward pointing arrow will appear next to the flow direction symbol. The P1 and P2 contacts will be in the mode stated in Section 4.2.9.

Max alarm >130%

3.3.11 Min Alarm

Min alarm can be set between 0 - 130%. If the flow rate falls below the alarm setting, a message will appear on the display. An optional low alarm contact is available at the customer terminals P3 and P4. The percentage of range required to activate the alarm is entered in this parameter. When the flow is less than the entered value, a flashing downward pointing arrow will appear next to the flow direction symbol. The P3 and P4 contacts will be in the mode stated in Section 4.2.9.

Min alarm <130%

3.3.12 Low flow cut-off

This feature allows for setting the low flow cut-off point in terms of percent of the full scale range setting. The cut-off causes the input signal to drop to a zero condition (4 mA dc for a 4-20 mA dc output) when the flow drops below the set value. This value can be set at 0 to 10% of the full scale

range setting. Typical values are 1 or 2%. If a value greater than 10 is attempted it will be rejected, and an error message will appear as shown below.

Error - - 16 Input > 10

3.3.13 Damping

Damping effectively controls the speed at which the signal converter responds to changes in flow. Without damping, it will show a 100% change in flow in about 1 second. By entering various values for damping, the full scale response can be slowed to as much as 99 seconds. This is not a linear function. Consequently, response will be faster in the first few seconds of the damping interval than during the last few seconds. Damping is sometimes used to smooth out pulsating flow signals that are caused by pumps and to reduce output oscillations that are created by process generated noise.

Damping 10.0000 s

Damping is a numerical value entry, and it is changed in the same manner as the range and other numerical units. Values greater than 99.9999 seconds will prompt an ERROR message.

3.3.14 Filter

A digital filter is installed in the Converter to provide a steady indication of flow and analog output for pulsating flows or noisy signals. With the filter switched on, damping settings can be reduced. Response time is not affected by activating this parameter.

Filter on/off

3.3.15 Density

If kg, tons, or grams is selected for the range or totalizer units a density value can be entered. The density can be entered between the values of 0.01 and 5 g/cm³. This is used as a factor against the range setting. For example, if the range setting is 250 kg/min a density setting of 2.00000 g/cm³ will change the range setting to 500 kg/min. Therefore, the pulse factor must be based on 500 kg/min.

Density 1.00000 g/cm ³

Density is a numerical value. It is entered in the same manner as the range setting. If values entered are not within the limits listed above an ERROR message will result.

NOTE

It is important to make changes to the parameters discussed up to this point in the order in which they have been presented. This will simplify the task and minimize the margin of error. From this point on, the parameters can be set randomly.

3.3.16 Flow

The upper line of the display is used to indicate flowrate in the monitoring mode. It can be expressed in % or in direct engineering units. Step through the menu until Flow appears on the upper line of the display. It might appear as shown below.

```
Flow
gpm
```

Because gpm was selected for range units in the previous example, that is the unit that appears here. The selections available for this parameter are engineering units, percent (%) and m/s (meters/second). Press the enter key, and the cursor will appear to the right of gpm. Now press the arrow key , and the value will change from the engineering units shown to % or m/s. Press the enter key, and the change is entered into memory.

3.3.17 System zero adj.

To make the adjustment, the magnetic flowmeter must be set up in a full pipe, no flow condition. Then call up the System zero adj. feature which should appear as shown below.

```
System zero adj.
0.0000 Hz
```

To access the zero adjustment, press the enter key, and the display will show:

```
Adjust ?
yes----> Enter
```

Press enter and the option to adjust manually or automatically will be offered.

```
Adjust
Automatic?
```

Select automatic, and press enter again. The zero will be adjusted. During the adjustment procedure, the display will show a count down from 255 to 0 (8 cycles). At the end of the count down, a frequency value will appear. If the value exceeds 1500 Hz an ERROR message will appear, and an adjustment to the magnetic flowmeter or Converter may be required. Record the value. If the Converter is changed, this value can be entered into the new Converter manually. It will not be necessary to set up a "full pipe no-flow" condition for this situation.

3.3.18 Submenu-Operating mode

3.3.18.1 Operating mode - Standard

Standard operating mode should be selected for uninterrupted flow measurement.

```
Operating mode
Standard
```

3.3.18.2 Operating mode - Piston pumps (pulsating flow)

Piston pump mode should be selected for pulsating flows. When a pulsating flow condition exists, the Filter parameter should be in the "on" position.

Operating mode Piston pumps

3.3.18.3 Operating mode - Flowmeter

The 50SM Converter is compatible with various F&P flowmeters. This parameter permits the selection of a preferred flowmeter (primary). Any one of the following flowmeters can be selected for use with the 50SM1000 Signal Converter.

1. Model 10DS3110 is an ac excited version of the Series 3000 primaries. Coil excitation is provided by an isolated 60 volt rms transformer winding. The reference voltage enters at terminals 16 and 3, and no reference resistance network is required on the converter base board. Under this arrangement, the reference voltage is 1250 times the value of a one foot per second electrode signal.
2. Models 10D1462 and 10D1472 are ac primaries excited directly from the 120 volt line service. The reference voltage enters at terminals 6 and 7, and requires a total of 1000 ohms terminating resistance on the base board. These meters produce a reference voltage 29,000 times greater than one foot per second flow signal.
3. Selection 10D1422 is used with primaries 10D1418 and 10D1430 which have an 81 ohm reference load resistance. The coils are powered directly from the ac line. Reference voltage enters terminals 6 and 7. These meters produce a reference voltage 29,000 times greater than one foot per second flow signal.

Note

The S901 switch on the terminal board (refer to Figure 6-1) located in the base of the Converter housing, must be set in the closed position (hooked) for all flowmeters except the 10DS3112, in which case it must be open (unhooked).

Primary

3.3.19 Submenu-Current output

The current output range is selectable. In addition to the 4-20 mA dc which is the normal output, 0-20, 0-10, and 2-10 are also available and selectable from the menu. In addition, the current output during an alarm condition can be set to either 0% or 130%. The display for these options appears initially as shown below.

Submenu Current output

At this point, press the enter keys, and the current output menu will be accessible. Move back and forth between the submenu items of Current output and I_{out} at alarm using the arrow key. Select either by pressing the enter buttons. Again, step through the submenu to select the appropriate current output or alarm output.

Current output
4-20 mA

Manual exit from any submenu is done in two steps. Pressing the C/CE key from either Iout at alarm or Current output will step the menu up to Submenu. Press enter to continue in the configuring mode or press the C/CE button again to exit from the configuration mode. The unit will return to the monitoring mode in two steps taking about 20 seconds between each step.

Iout at alarm sets the analog output to a low or high value as selected. In case of an operational failure, the computer activates an alarm, an error message is sent to the display, and the current output goes to the selected value. The selected value can be either 0% or 130% of the range setting. The Iout at alarm menu appears as shown below:

Iout at alarm
0%

3.3.20 Submenu-Data link

If the Data link option has been installed it is configured by calling up the data link submenu which appears in the display as shown below. If the Data Link option has not been installed a "NOT AVAILABLE" error will appear.

Submenu
Data link

If the Data link option is available, press the enter key, and the Communications menu will appear as shown below.

Communications
uDCI Binary

Press the enter key again, and select uDCI Binary or ASCII.

Press an arrow key, and the menu will change to the Baudrate menu as shown below.

Baudrate
2400 Bd

Press the enter key, and select one of the following baud rates: 110, 300, 600, 1200, 2400, 4800, 9600, 14400, 28800.

Press the arrow key, and the menu will change to the instr. address as shown below.

Instr. address

Each Converter included in the data link must be identified by a unique numeric address. These are limited to the numbers 00 to 31. An attempt to enter a number higher than 031 will result in an ERROR message.

3.3.21 Submenu-Self check

A number of self test routines are built into the Converter. Some of these are software driven checks and some are performed with a combination of software and continuity checks.

NOTE

The Converter is not "on line" during Self Check. This is a maintenance procedure, and data is not updated while the Converter is in this mode.

Submenu
Self check

Press enter and the following will appear in the display.

Self check
I_{out}

Press enter again, and I_{out} will disappear and the % sign will appear on the right in the bottom line. A percentage of the output can now be entered, and the analog output will go to that value. For example, enter 25, and the analog output will go to 8 mA dc. To exit the I_{out} test and any other Self Check test, press C/CE.

I_{out}
0%

Press the arrow key and the NVRAM check will appear as shown below.

Self check
NVRAM 22C12

Press enter and an NVRAM OK or an ERROR message will appear in the display.

Press the arrow key and the EPROM check will appear as shown below.

Self check
EPROM 27C512

Press enter and an EPROM OK or an ERROR message will appear in the display.

Press the arrow key and the EEPROM check will appear as shown below.

Self check
EEPROM 93C46

Press enter and an EEPROM OK or an ERROR message will appear in the display.

Press the arrow key, and the following will appear.

Self check Alarm contact

This test checks the alarm contact for operation. It can be tested for continuity with the alarm on in the same manner as the flow direction contact at terminals V5 and V6 in the remote Converter.

Press enter, and the display will show "Alarm contact" on the top line and either "Off" or "On" on the bottom line. Press the arrow key to switch from "On" to "Off". Continuity should be present when the menu reads "On".

Press the arrow key, and the following will appear.

Self check Dir. contact

This test checks the flow direction contacts for the analog signal. Place an ohmmeter across terminals 44, 45 and 46 in the remote connection box. Continuity should be present on terminals 44 and 45 for reverse flow and terminals 45 and 46 for forward flow. Press enter, and reverse or forward will appear in the display. Press the arrow key to change from one to the other.

Press enter, and the following will appear.

Self check P1-P2 contact

Before the start of this test, disconnect field wiring to P1 and P2. To start the test press an arrow key and the upper display line will read "P1-P2 contact" and the lower line will read **off**. Press an arrow key and the lower line will read **on**. Re-connect field wiring after completion of test.

Press enter, and the following will appear.

Self check P3-P4 contact

Before the start of this test, disconnect field wiring to P3 and P4. To start the test press an arrow key and the upper display line will read "P3-P4 contact" and the lower line will read **off**. Press an arrow key and the lower line will read **on**. Re-connect field wiring after completion of test.

Press the arrow key, and the following will appear. The S206 Switch test is for F&P use only

Self check
Switch S206

Press enter, and the following will appear. The S207 Switch test is for F&P use only

Self check
Switch S207

Press enter, and the following will appear. This test is not applicable to the 50SM1000.

Self check
Input A1

Press enter, and the following will appear. This test is not applicable to the 50SM1000.

Self check
InputA2

Press Data, and the following will appear.

Self check
Data link

The Data Link check requires that jumpers be installed in the wiring so that the converter can transmit and receive its own signal. For the RS 232 link, place the jumper between terminals TD and RD. For the RS 485 link, place a jumper between terminals T- and R- and another between T+ and R+. These terminals are located in the Converter customer connection box.

Press enter. The computer will output 1000 characters of ASCII code 31 Hex ("1") and check the received characters. In the display, the output data count appears on the left, and the error data count appears on the right. After 1000 characters are sent, the computer ends the check on the received data and continues to transmit the value 31 Hex until the C/CE button is pressed.

Press the arrow key, and the following will appear.

Self check F _{out}

A self test of the frequency output will test the 0 to 10KHz unscaled output, and the optional scaled pulse output if it is present in the converter. If it is necessary to thoroughly test the scaled output, some anomalies must be considered.

It is assumed that the self test will be performed on the installed system and not when connected to a flow simulator. When the former is the case, the scaled pulse output will be active for that flow direction indicated at the time the self test was invoked.

Assume a bi-directional system set to a range of 60 gpm and a pulse factor of one per gallon. If the indicated flow was reverse 10 gpm when self-test F_{out} was invoked, then entering 100% will produce 1 pulse per second at terminals 9 and 11R and 10KHz at terminals 8D and ground (G3). No pulses will be present at 9 and 11. Negative entries are not permitted for a test value.

In order to have the above situation produce pulses at 9 and 11, it will be necessary to short the electrode signal (1 and 2) and use a negative manual system zero to place the converter output positive before invoking self-test. **Record any previous system zero value so it may be re-entered following self-test.**

Press the arrow key, and the following will appear.

Self check Display

Press enter, and the display will fill up with the numbers 1 through 0 and the letters A through F to show that the display is functional.

Press the arrow key, and the following will appear.

Self check Zero return

This test checks the external contact operated Zero Return feature. Press enter. The display should read "Zero return off". Place a jumper across terminals 22 and U2, and the display will change to "Zero return on".

Press the arrow key again, and the following will appear.

Self check Totalizer reset

This test checks the external contact operated Totalizer Reset feature. Press enter. The display should read "Totalizer Reset off". Place a jumper across terminals 31 and U2, and the display will change to "Totalizer Reset on". Remove jumper after test. The totalizer value is not effected by this test.

3.3.22 Submenu-Detector e. pipe

This empty pipe detection feature is a factory installed option. It is designed to sense that the liquid in the magnetic flowmeter has dropped below the level of the electrodes. When this happens, the outputs are locked at zero flow (4 mA dc and 0 Hz typically) or 130% of range setting depending upon which of these values has been selected for the "I_{out} at alarm" condition.

This function is either ON or OFF. It is activated or deactivated by finding it in the menu and pressing the enter key. Next, press arrow key to change from ON to OFF or vice versa. Press the enter key again to enter the selection.

In order to use this feature, certain adjustments must be made with the magnetic flowmeter installed in the pipeline under both full pipe and empty pipe conditions. First, call up the Empty Pipe Menu.

Submenu
Detector e. Pipe

Now press enter and the display will show either an ERROR message if the option has not been installed or the menu as shown below.

Adjust
Detector e. pipe

Press the enter key and a numerical value will appear in the display. With the pipe full of the process liquid, adjust potentiometer R813 on the Empty Pipe Detector Board until the value in the display reads 100.

At this point, drain the liquid from the pipe and note the value in the display when the pipe is empty. Calculate the threshold value using the following equation:

$$\text{Alignment value} = \frac{100 + \text{pipe empty value}}{2}$$

Press the arrow key until Threshold appears in the display as shown below:

Threshold
062

Press enter and change the numerical value that appears on the second line of the display to the alignment value calculated above.

3.3.23 Totalizer >F/<R

The Forward and Reverse totalizers can be reset to zero individually. Toggle through the menu until the Totalizer> F reset message appears in the display. Forward or reverse flow will be indicated by "> F" and "< R". Press the enter key, and the appropriate counter will be reset to zero.

3.3.24 Overflow >F/<R

When the totalizer reaches its maximum count (9,999,999,) it "rolls over" and starts to count again at zero. When this occurs, the direction indicator (> F or < R) at the left of the register and the units

(ie. gal) at the right of the register will blink, and an overflow register will record the overflow. The cumulative total can be determined by multiplying the number in the overflow register times 9,999,999 and adding the value in the totals register. The overflow message is removed by toggling through the menu using the arrow key until "Totalizer reset" appears. At this time, pressing the enter keys will reset the totalizer, clear the overflow register, and the blinking will stop.

3.3.25 Error Log

 
Alarm conditions may exist momentarily. For example, the flow may exceed 130% of the range setting for a short period of time and return to normal before the alarm condition is detected. The Error Log records the code number of any alarm conditions as they occur. For flows that exceed 130% of range setting, the error code is the number 3 (refer to Section 3.4). This number would appear in the error register along with the code numbers of any other failures that have occurred. The code numbers are cleared from the error register by pressing the enter key.



3.3.26 Multiplex displ.

The totalizer value on the bottom line of the display shows the total for the operating flow direction. It can be made to show totals for the opposite direction either manually or automatically if the unit has been set up for bidirectional flow. If not then this feature will be locked out. Totals for the opposite flow direction can be displayed manually by pressing the +/- TOT key. The total will be momentarily switched to show the totalized flow for the opposite flow direction. After about twenty seconds, the flow totalizer will revert to show the total for the current flow direction.

The Multiplex feature automatically switches the totalizer values so that they are alternately displayed for each flow direction. A total for one direction will be displayed for 20 seconds and then the other for 20 seconds. This will continue for as long as the Multiplex feature is turned on. It is an "ON" - "OFF" function that is selected by the arrow key and entered with the enter key.




3.3.27 Load and Store Configuration Data from the External EEPROM

Configuration data associated with a 50SM1000 and a specific flowmeter can be saved in the EEPROM located in the base of the Converter enclosure. If the converter (plug-in) module is replaced or installed in another converter, the data can be retrieved without requiring re-entry.

3.3.27.1 Store Data in the External EEPROM

 Data must be initially be placed in the external EEPROM using the "store" command. This will clear any erroneous data in the EEPROM. Any new configuration data will be automatically saved in the external memory as it is changed.



3.3.27.2 Load Data from the External EEPROM

When a new Converter module is installed in the Converter enclosure, the "load" command may be used to retrieve the data associated with the flowmeter. Calibration data for the converter module is not saved in the external memory since it is associated with the module itself. Also, totalizer values are not saved in the external memory.

Load data from
ext. EEPROM

3.3.28 Software Level

The software level and the Converter model number are shown in the display with the model number and software release date on the top line and the EPROM identification and software level on the bottom line. Changes to the software can only be made by replacing the EPROM.

50SM10000 01/91
D699B101U01 A.11

3.3.29 Code number

The Code number is used to gain access to internal checks and adjustments that are not normally performed by operator personnel. These are reserved for factory and maintenance personnel. Instructions for these procedures are contained in Section 5.0. The Code Number display appears as shown below.

Code number

3.4 Error Messages

Error messages replace the flow rate indication in the display when certain failure conditions exist or when an attempt has been made to enter an unacceptable value. The various error messages are shown below.

<u>ERROR #</u>	<u>CAUSE</u>
0	Empty Primary
1	A/D converter overranged
2	Reference voltage too low or too high
3	Flow is greater than 130%
4	Remote cut-off contact activated
5	Error in EEPROM data
10	Input >1.00 Qmax DN >10 m/s
11	Input <0.05 Qmax DN <0.5 m/s
12	Qmax DN not programmable
13	Qmax DN ≤0
16	Input >10% low flow
17	Input <0% low flow
20	Input ≤100 seconds damping
21	Input <0.1 second damping
22	Input >99 instrument address
24	Input >8 baud rate
30	Input >40 meter size
36	Input >1 language
38	Input>1000 pulse/unit
39	Input ≤.001 pulses/unit
40	Maximum totalizing frequency scaled pulse output >10 kHz
42	Input >2000 ms pulse width
43	Input <0.032 ms pulse width

- 44 Input >5.0 g/cm³ density
- 45 Input <0.01 g/cm³ density
- 46 Input >2 instantaneous value
- 48 Wrong number for unit Qmax
- 50 Input not 0 or 1 filter
- 52 Wrong number for flow rate totalizer
- 54 System zero point >1500 Hz
- 74 Input >130% max. alarm
- 76 Input <130% min. alarm

4.0 FUNCTIONAL DESCRIPTION

4.1 Basic Functions

The 50SM Microprocessor-based Signal Converter is of the ac type, i.e., a 60 Hz sine wave is applied to the magnet coils of the flowmeter to establish the magnetic field. The converter receives the flow signal and a reference voltage from the Magnetic Flowmeter and converts these into analog and digital output signals.

4.2 Design Features

4.2.1 Micro-processor Controlled

The Converter is microprocessor-controlled with nonvolatile memory. All operating parameters are configurable via the keypad on the Converter and via an optional data link. During configuration, the Converter remains on line, and data is updated continually. The data base is updated at the time the ENTER button is pressed to enter a parameter change.

4.2.2 Display

The liquid crystal display (LCD) is back lighted and contains two lines of 16 alphameric (5 X 7 dot matrix) characters. The display is used to show flow rate on the top line in either percent of flow or in direct engineering units and totalization in direct engineering units on the bottom line (see Figure 3-1). In addition, the display is used to show configuration data or error messages. Both the rate indicator and the seven digit totalizer are included in every Converter as standard.

4.2.3 Rangeability

Any range from 0 to 100% can be selected provided the full scale value is between 33.33 ft/s (10 m/s) and 1.5 ft/s (0.5 m/s).

4.2.4 Bi-Directional Flow

The Converter can be either unidirectional or bidirectional. Selection of the bi-directional mode is made through software. This can easily be changed in the field. The standard mode is unidirectional. Instructions for this software change are contained in Section 5.0. In the bidirectional mode, the Converter will automatically display rate and totalization in forward and reverse directions. A pulse output option for each direction is available for retransmission to an external totalizer. A flow direction contact is included in the 50SM1000 to indicate flow direction for the one analog output.

4.2.5 Flow Direction

The flow direction is indicated at the left side of the display as ">F" for forward flow and "<R" for reverse flow. Totalization is also shown in this manner. The totalizer can be switched manually from forward to reverse or vice versa by pressing the Tot. +/- key. The totalizer can be set to switch automatically every 20 seconds by selecting MULTIPLEX DISPLAY "ON" from the configuration menu.

There is one analog output available. Flow in the reverse direction is indicated by the same analog signal as the forward. To make the distinction between forward and reverse flow, contact closures are provided in the 50SM1000. In a two pen recorder, for example, one pen could be used to record flow while the second pen could rest at zero with the contact open and could be elevated to some positive value when the contact closes. Thus, the position of the second pen would indicate the direction of flow. If the analog signal goes to a computer or CHAMELEON type instrument the contact closure condition is easily recognized as an indication of flow direction.

4.2.6 Output Signals

4.2.6.1 Analog Output

A 4-20 mA dc output signal into 0-500 ohms is standard and is always available regardless of which output options are selected.

4.2.6.2 Optional Outputs

Either a scaled pulse output or a data link can be selected.

4.2.6.3 Scaled Pulse

This is a 24 V dc pulse that can operate a minimum load of 150 ohms. It can be used to drive an electromechanical counter at 0-10 Hz with a 50 millisecond pulse width or a high speed electronic device at 0-4 kHz with a 50 microsecond pulse width. The pulse width can be adjusted as a part of the data base and does not require a hardware change.

4.2.7 Data Link

The data link is the hardware and software by which the data base may be examined. The data base is a collection of elements in the Converter memory which may be either altered or examined through software. In addition, the data base represents the information the instrument is working with in the course of its normal computations. A few of the parameters included in the data base are calibration factor, range setting, damping value and pulse width. The data link consists of two transmitting and two receiving wires which pass serial data at 110 bits per second up to 28,800 bits per second (110 Baud to 28.8 kBaud). It does not carry the analog output signal from the Converter. The analog signal is carried over its own wires directly to the receiving device (recorder, controller, indicator, computer, etc.) in the normal manner. There are two industry standard hardware arrangements for the data link option. They are RS232C and RS485.

RS232C interface is probably the most common serial data link in use today. It permits communication between two devices normally within fifty feet of each other at baud rates up to about 9600. Devices are available to convert from RS232C to RS485 to allow connection of more than one Converter to a single computer and to transmit well beyond fifty feet.

RS485 interface is a high speed link used by F&P's MICRO-DCI instrument line as well as other intelligent instruments. It permits any transmitter to be shut off or 'tri-stated' when not in use. For F&P instruments such as the SUPERVISOR, it means that up to 32 instruments may 'talk' over one data link. This link can send data at 28.8 kBaud over lines up to 4000 feet long. Two key pad selectable communication modes are available. They are MICRO-DCI Binary and ASCII.

4.2.7.1 ASCII

In the ASCII mode, a sequence of ASCII characters is sent back and forth.

4.2.7.2 MICRO-DCI Binary

This mode is the most powerful communications scheme available. It will be recognized by the following instruments:

- 1) SUPERVISOR & SUPERVISOR-PC (53SU1000 & 53SU5000).
- 2) MS-DOS Personal Computer with F&P software (53HC3300)
- 3) DCI SYSTEM using I-COM/X and SUPERVISOR

In the binary mode, information is compressed so that it is sent approximately twice as fast as in the ASCII mode. However, this format will not be recognized by "dumb" terminals. The binary mode interface provided by F&P permits the user to write programs which automatically extract or change data. In each of the above cases, these programs are written in a different notation, with the MS-DOS Personal Computer version using BASIC with customized subroutine calls.

4.2.8 HART Interface

The optional HART protocol system, when supplied, permits simultaneous 4-20 mA and digital signal transmission on the same 2-wire cable. With this protocol, process parameters such as instantaneous flow rate and cumulative total flow, or operating conditions such as alarm values, can be monitored or altered by an external "smart" device, e.g., a host computer. This interface allows the 50SM1000 data base to be uploaded into the host computer. Operating parameters which would only be changeable at the 50SM Converter can be scanned and remotely reconfigured.

Software and hardware are optionally available to implement a HART Protocol information exchange between the converter and the F&P 50HC1000 hand-held computer. This data link permits continuous monitoring of process variable and totalized flows and provides for configuration of the following:

- Values and units for range
- Pulse factor and units for totalizers as well as reset capability
- Damping, noise reduction, low flow cutoff value
- Empty pipe detector setup
- Alarm fail safe condition
- Converter tag name and record information
- Calibration of the analog (4 - 20 mA) output

The following parameters may be displayed but not configured:

- Meter size and calibration factor
- Instrument type (50SM1000) and manufacturer (F & P)
- Totalizer overflow values

Refer to the 50HC1000 Hand-Held Computer Instruction Bulletin for detailed information regarding application of HART Protocol.

When implementing the HART protocol, the control computer is the master and the field transmitter the slave. In addition to this primary master a second master (such as the Series 50HC1000 Hand-Held Computer) can become active. Data is transmitted at 1200 baud, with the serial information being encoded and detected as outlined in the Bell 202 standard.

4.2.9 Optional Features on Base Board

The base board used in the 50SM converter provides several functions, including the following:

- Customer connections to primary and other field wiring
- Reference voltage termination for 81 and 1000 ohm units
- Configuration memory
- Relays or optocouplers for alarm and direction options
- Connection interface to converter plug-in module

The customer connection board contains four 16 pin IC type sockets which accommodate relays or opto couplers, as specified in the model number. Direction indication is always accomplished using a form C (SPDT) relay, A903. Figure 6-1 shows the locations of the sockets for A901 through A904. Excepting A903, the operation of the relay contacts (normally open or normally closed) may be selected using the switches adjacent to them.

The following is a listing of terminals associated with the various contact outputs and their operating modes:

Option	Terminals	Operation
error alarm	V5(E)*, V6(C)*	closed with no errors (Pos. "1")**
direction	44,45(com),46	45 to 46 closed forward, 45 to 44 closed reverse
low threshold	P3(E), P4(C)	open at no alarm (Pos. "1")
high threshold	P1(E), P2(C)	open at no alarm (Pos. "1")

* (E)= emitter, (C)= collector (positive)

** Pos. "1" applicable for relay option only

4.2.10 Reference Voltage and Impedance

Proper measurement of flow rate requires not only a signal from the electrodes, but also a signal from the primary which is related to the coil excitation current, referred to as the reference voltage. The reference voltage is developed by one of two methods, depending on the type of primary. For Model 10DS3110 flowmeters, a current sensing resistor is placed directly in series with the coils, which are driven by an isolated 60 V ac transformer winding. This reference voltage, which is nominally 100 mV rms, is present at terminals 16 and 3 of the flowmeter. Flowmeters 10D1418, 10D1430, 10D1462 and 10D1472 have their coils operated directly from the power line, and the reference is isolated by a current transformer requiring a precision terminating resistance of either 81 ohms (10D1418/10D1430) or 1000 ohms (10D1462/10D1472). The 50SM1000 converter has the appropriate components placed on its base board to accommodate the 81 or 1000 ohm reference loads. These are connected to terminals 6 and 7 and provide voltage division down to a nominal 100 mV rms level, which can be measured at terminals 16 and 3.

Switch S901 (refer to Figure 6-1) on the base board is used to switch the 81 or 1000 ohm references into terminal 16 of the converter so that their measurement will take place, and must be left open when using a reference that comes directly into 16, as when calibrating the converter.

The menu selection in the "operating mode" provides the proper calculation for the divided reference voltage when in the 81 ohm, 1000 ohm, or undivided mode. In all cases, the voltage

measured at terminals 16 and 3 must be in the range of 50 to 150 mV rms or a reference voltage error message will appear.

4.2.11 Power

Refer to the Converter instrument tag for specific power requirements.

Voltage	115 V ac \pm 10% or 230 V ac \pm 10%
Line Frequency	47 - 53 Hz or 56 - 64 Hz
Power Consumption	< 30 VA (applies to the Converter only, but includes the excitation current for models 10DS3111 and 10DS3112)

5.0 CALIBRATION

5.1 General Discussion

NOTE

The 50SM Signal Converter should never require recalibration, unless a hardware failure has occurred. If the NVRAM proves defective, calibration data must be reentered. In the event of component failure, existing calibration data may no longer be valid.

One notable feature of the type 50SM Converter is that it can be configured independent of any particular primary. The design of the microprocessor-based 50SM Converter permits configuration and calibration of the Converter prior to its installation.

Each Converter is configured and precisely calibrated at the factory in accordance with customer specified flow parameters.

Since the flow metering system is precalibrated, it is generally ready for on-line service as received. In the event that the specified system flow parameters or engineering units are to be changed, the Signal Converter must be reconfigured to agree with the revised flow values.

Signal Converter performance can be verified periodically using the procedure described in Section 5.3. If problems are experienced which may be originating with the Signal Processor, use the performance verification procedure first. Recalibration should be done only when it has been determined that it is actually required. If calibration is necessary, it can be done using the procedure described in Section 5.7.

Essential calibration data is recorded and listed on a data tag that is attached to the side of a transformer in the Signal Converter assembly. The calibration data provided can be used to restore the signal converter to a calibrated condition when data held in the NVRAM has been corrupted. RAM corruption can result from a lightning strike or severe electrical disturbance near the installation site. Before recalibration, data from the external EEPROM should be uploaded. If data in the external EEPROM is also corrupted, all of the calibration data must be re-entered. If the Signal Converter has malfunctioned and a defective component must be replaced, the calibration data is no longer valid; the unit must be recalibrated as described in this section.

5.2 Test Requirements

5.2.1 Equipment

Test equipment needed for Signal Converter calibration/testing includes the following:

- 1) a) Model D55XC2000 Simulator with ac adaptor
- 2) Electronic Totalizer/Frequency Counter (0-10 kHz)
- 3) Digital Voltmeter (typically, 0-10 V dc)
- 4) Electromechanical Counter or Electronic Totalizer (as applicable for 0-15 Hz* max, or 0-4 kHz)
- 5) 250 ohm $\pm 0.05\%$, 1/2 W, precision resistor

*assumed maximum count rate of electromechanical counter

Typical test wiring is shown in Figure 5-1. Interconnection wiring diagrams for the 50SM Signal Converter are included in the Installation Section and should be used to supplement this discussion.

Use of an F&P Model 53SU1000 SUPERVISOR, 53SU5000 SUPERVISOR-PC, or similar intelligent data handling equipment will be needed for interfacing with the RS 232C or RS 485 I/O signals, when supplied. Signal wiring is shown on the applicable system interconnecting diagram. When communication is implemented via the HART Protocol, applicable interconnection diagrams are contained in the technical literature provided for the particular communicator; e.g., the Hand-Held Computer (IB 50HC1000).

5.2.2 Signal Simulator

The model D55XC2000 Signal Simulator provides an adjustable process variable flow signal suitable for on-site performance and accuracy tests of the 50SM1000 Signal Converter.

A three decade digital switch can be set from 0 to 9.99 meters per second. A two position switch changes flow from forward to reverse for bi-directional flow. A CMR switch for verification of common mode rejection is provided.

An adaptor with shielded cables is supplied for interconnecting the Simulator with the Converter.

Attachment of the test cables from the Signal Simulator to the Signal Converter is illustrated in Figure 5-1. The verification procedure is described in Section 5.3.

5.2.3 Signal Converter Disassembly

Should it become necessary to disassemble the Signal Converter for calibration and/or testing proceed as outlined below.

5.2.3.1 Removing the Signal Converter from the base

WARNING

Equipment powered by an ac line service constitutes a potential lethal electric shock hazard. Installation and servicing of the Magnetic Flowmeter and Signal Converter should only be attempted by a qualified electronics technician. Make certain that the power input leads are disconnected from the operating circuit before attempting electrical connections.

- 1) To remove the Converter cover, unscrew the four mounting screws located in the corners of the cover. These are captive-type screws and should not be removed from the cover. Store the cover for reassembly.
- 2) On top of the Digital board, unscrew the four screws that pass through the standoffs located near the corners of the Converter assembly. Lift the Converter assembly carefully so that the interconnecting terminal connectors between the Converter assembly and the terminal board in the base will not be damaged. Save all mounting hardware.

5.2.3.2 Disassembly of the Signal Converter

To gain access to the Analog Board, it may be necessary to separate the Analog and Digital boards. If applicable, proceed as outlined below.

- 1) Unscrew the four hex nuts that secure the Digital Board to the standoffs. Save all hardware.

The Digital board can then be lifted slightly and tilted up (away) from the Analog board.

- 2) If it is necessary to separate the Analog and Digital boards, disconnect the interboard cable.

The Converter assembly can be reassembled by performing the above procedure in reverse order.

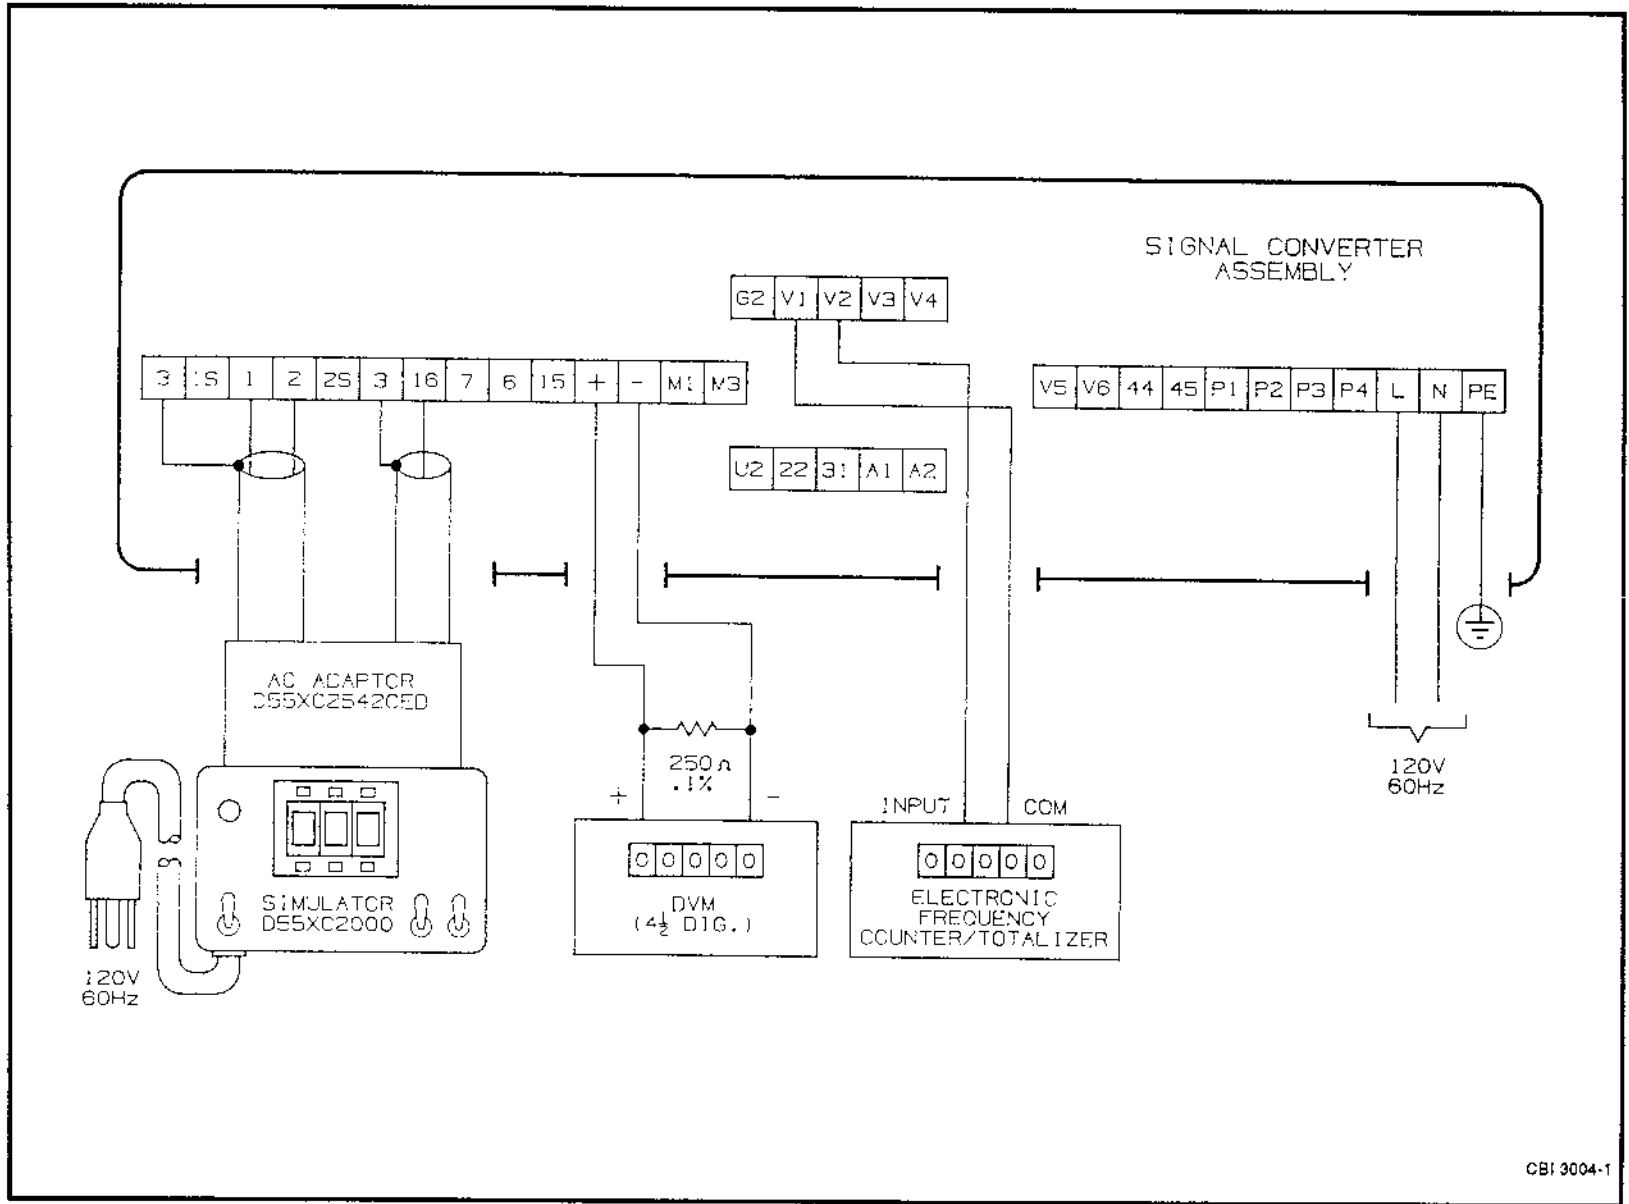


FIGURE 5-1. TEST WIRING USING SIGNAL SIMULATOR D55XC2000

CBI 3004-1

5.3 Performance Verification

To verify calibration of the Converter, connect the Simulator 55XC2000 Simulator with ac adaptor as shown in Figure 5-1.

NOTE

Prior to performing verification and/or calibration, the S901 switch located on the terminal board must be set in the open (unhooked) position (refer to Figure 6-1). For normal operation, the S901 switch must be set in the closed position (hooked) for all flowmeters except the 10DS3112, in which case it must be open (unhooked).

CAUTION

When the dynamic test is to be made in the customer's Instrument service shop, especially if the total volume processed is needed for inventory or billing purposes, the total volume should be logged before disrupting electrical interconnections.

Enter a range value on the 3-digit range selector and read the output on the Converter assembly liquid crystal display or metering devices connected to the Simulator output(s).

For ... Qmax DN velocity = 33.33 ft/s

The indicator reading can be calculated as follows:

$$\% \text{ Indicator Display} = \frac{\text{m/s}}{10.159} \times \frac{\text{Cal Factor}}{\text{Range} > \text{F or} < \text{R}} \times 100$$

where, m/s = Simulator velocity setting

Alternatively, if the Converter is set up for max flow velocity (QmaxDN) = 10 m/s, then the % Indicator Display calculation would be as follows:

$$\% \text{ Indicator Display} = \frac{\text{m/s}}{10.00} \times \frac{\text{Range DN}}{\text{Range} > \text{F or} < \text{R}} \times 100$$

For example, assume the primary is a 2 inch meter with a Cal Factor of 268.372 gpm at 33.33 ft/s, that the Signal Simulator is set for 5.00 m/s, and Range > F is preset for 250 gpm max, then:

$$\begin{aligned} \% &= \frac{5.00}{10.159} \times \frac{268.372}{250} \times 100 \\ &= 52.8 \end{aligned}$$

If the current output is preset for 0-20 mA* and the load resistor (Rx) is 250 ohm (refer to Figure 5-1 Test Wiring), then the voltage reading displayed by the DVM should be:

* HART units cannot be changed when output is set at 4-20 mA.

$$\begin{aligned}
 E &= I_{\max} \times \frac{\text{Indicator \%}}{100} \quad (Rx) \\
 &= 0.020 \times \frac{52.8}{100.0} \quad (500) \\
 &= 2.64 \text{ V dc}
 \end{aligned}$$

The flow velocity in ft/s at the operating flow rate can be calculated as shown below.

$$\text{ft/s} = \frac{\text{Oper(gpm)} \times 33.33}{\text{Calfactor(gpm)}}$$

Using values given in the above example,

$$\text{ft/s} = \frac{250 \times 33.33}{268.372} = 31.0$$

To convert velocity in ft/s to m/s,

$$\text{m/s} = \frac{\text{ft/s}}{3.2808}$$

typically,

$$\text{m/s} = \frac{31.0}{3.2808} = 9.45$$

When satisfactory performance has been demonstrated, select the desired current output span (0-20/4-20/0-10/2-10 mA) before returning the Converter to service. Standard output is 4-20 mA.

5.4 Initialization

The last item in the calibration menu sequence is "initialization". If this item is selected all parameters are set to the default values, replacing the factory-installed settings. Therefore, extreme caution should be exercised in using "Initialization". In general, "Initialization" need only be performed if there has been a loss of data in NVRAM memory which cannot be recovered from the external EEPROM. If a record of the calibration data is available from the tag, the data should be re-entered following the initialization. Otherwise, the unit must be calibrated again to place it back to within specified accuracy.

5.5 Menu Sequence

The following list represents the display menu sequence of the Series 50SM1000 Converter design level B when running software version A.11 and using the arrow buttons to move forward through the menu items. The first message displayed the first time the "↑" arrow button is pressed after the Converter is powered up is "Prog. Protection ON". Thereafter, pressing the "↑" arrow button while the Converter is in monitoring mode will display the parameter on display when configuration or calibration mode was last exited. There is wraparound between the last and the first items on the menu.

The menu items beginning the list are configuration mode functions. Calibration mode items are those items on the list following "code number". These items are preceded with " * " on the list; these calibration mode functions are inhibited unless "Code 1000" is selected. Submenu lists (preceded with a "+") only appear if the associated upper level is selected.

Where an item has two simple choices, the second selection is shown following a "//".

```
Prog. protection
on//off
```

```
Language
English
```

```
Meter size   (not applicable to instruments sold in the U.S.)
****
```

```
Range unit
gpm
```

```
Range DN  10m/s
8.66748 gpm
```

```
Range
7.92516 gpm
```

```
Totalizer unit
gal
```

```
Pulse factor
1.00000 / gal
```

```
Pulse width
30.000 ms
```

```
Max Alarm
130%
```

```
Min Alarm
00%
```

Low flow cut-off
1.0000 %

Damping
1.0000 s

Filter
on//off

Density
1.00000 g/cm³

Note: May only be changed
when units are mass.

Flow
% //-selected units-

System zero adj.
0.0000 Hz

Submenu

Operating mode

- + Operating mode
 - Standard
 - Piston pumps (pulsating flow)
- + Primary
 - 10D1472
 - 10D1462
 - 10D1422
 - 10DS3110
 - 10DI1425

Submenu

Current output

- + Current output
 - 4 - 20 mA
 - 0 - 20 mA
 - 0 - 10 mA
 - 2 - 10 mA
- + Iout at alarm
 - 0 % //130 %

Submenu

Data link

- + Communication
 - uDCI binary //ASCII // HART
- + Instr. address
 - 000
- + Baudrate
 - 1200 bd

Submenu

Self check

- + Self check
Iout
- + Self check
NVRAM 22C12
- + Self check
EPROM 27C512
- + Self check
EEPROM 93C46
- + Self check
ext. EEPROM 93C46
- + Self check
Alarm contact
- + Self check
Dir. contact
- + Self check
P1 - P2 contact
- + Self check
P3 - P4 contact
- + Self check
Switch S206
- + Self check
Switch S207
- + Self check
Input A1
- + Self check
Input A2
- + Self check
Data link
- + Self check
Fout
- + Self check
Display
- + Self check
Zero return
- + Self check
Totalizer reset

Submenu

Detector e.pipe

- + Detector e.pipe
on //off
- + Threshold
070
- + Adjust
Detector e.pipe

Totalizer >F

reset

Overflow >F

000

Totalizer <R
reset

Overflow <R
000

Error log Shown with no
. errors present.

Multiplex displ.
on //off

Load data from ext. EEPROM

Store data in ext. EEPROM

D50SM1000 01/91 Note: Other program versions
D699B101U01 A.11 may vary.

Code number
1000//0

* QmaxDN velocity
10 m/s

* Span adjust >F
97.38 %

* Span adjust <R
-97.60 %

* Zero adjust
1.000

* Adjust Iout 100%
90.00

* Adjust Iout 20%
19.70

* Calibration
on//off

* Adjustment of
Integrators

* Range DN
fixed //programmable (fixed mode is not applicable on instruments
sold in the U.S.)

* Flow direction
forward/reverse //forward

- * Instrument no.
0
- * Mains interrupt
- * ** RESET **
- * Output data
- * Initialization
- * Analog Range Read Only. Not software selectable.
1 m
- * Excitation Read Only. Not software selectable.
60 Hz

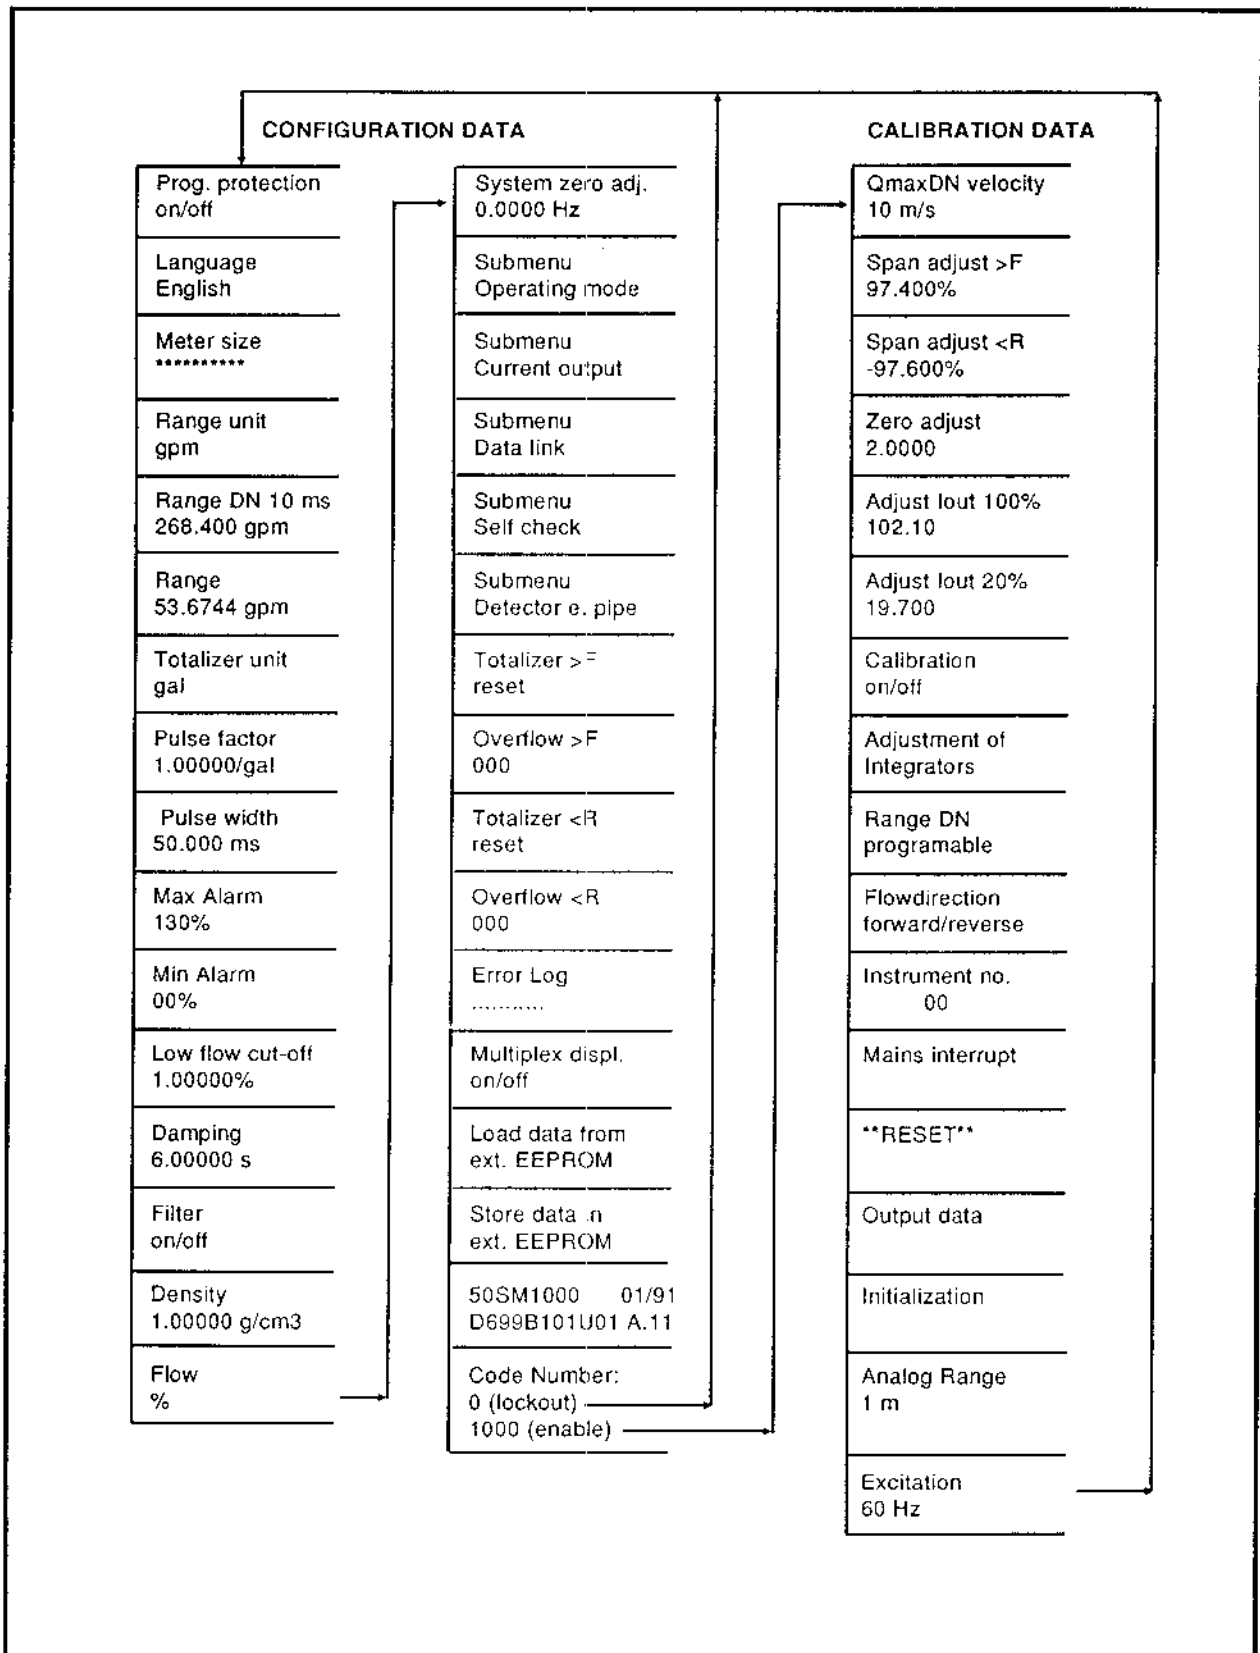


FIGURE 5-2. CONFIGURATION AND CALIBRATION OVERVIEW

5.6 Engineering Units

Available flow units are listed below. Entries for volumetric units followed by a "/" may use any of the units of time following the "/". Entries preceded with a "^" permit use of a density entry other than 1.000.

```
l/s /min /h
hl/s /min /h
m3/s /min /h
igp/s /m /h
gp/m /h
mgd
bbl/s /min /h (bbl = 31gallons)
bls/day /min /h (bls = 42 gallons)
^ kg/s /min /h
^ t/s /min /h (metric ton = 1000 kgm)
^ gram/s /m /h
ml/s /min /h
```

The following are totalization units available:

```
l
hl
m3
igal
gal
mgal
bbl (bbl = 31 gallons)
bls (bls = 42 gallons)
^ kg
^ t (metric ton = 1000kg)
^ gram
ml
```

5.7 Calibration Procedure

NOTE

The 50SM Signal Converter should not require recalibration in its lifetime, unless a hardware failure has occurred. If the NVRAM and EEPROM prove defective, calibration data must be reentered. In the event of component failure, existing calibration data may no longer be valid.

The F&P Type 50SM Converter software includes some configuring routines whose use permits special entries specific to the calibration of the device to be set. When the calibration mode has been invoked, it is possible to access parameters normally blocked because they are either linked to options not installed or because they are not compatible with other parametric settings.

For example, the software includes an automatic module identification for the RS485 and RS232 serial interface modules. When configuring the 50SM, the parameters "Instr. address", "Baudrate" and "Communication" in the "Data link" submenu are programmable only if a serial interface module has been installed. The absence of such a module is indicated by "ERROR-NOT AVAILABLE" on the display whenever an attempt is made to call up that parameter. However, in the calibration mode, any of these menu items may be accessed and changed even if the proper module has not been installed.

NOTE

This procedure has been prepared for use with software version A.11 of the F&P type 50SM Signal Converter. Other versions will be similar but not necessarily identical and may have features different from those discussed in this section.

CAUTION

Only experienced electronic technicians should attempt to calibrate the Signal Converter. Erroneous calibration will result in unsatisfactory performance.

CAUTION

Some of the surface mounted IC devices used in the Signal Converter are static sensitive and may be damaged by improper handling. When adjusting or servicing the Signal Converter, use of a grounded wrist strap is recommended to preclude inadvertent damage to the integral solid state circuitry.

NOTE

Prior to performing verification and/or calibration, the S901 switch located on the terminal board must be set in the open (unhooked) position (refer to Figure 6-1). For normal operation, the S901 switch must be set in the closed position (hooked) for all flowmeters except the 10DS3112, in which case it must be open (unhooked).

5.7.1 Code Number

Access to special functions including calibration parameters is achieved by entering the proper code number. In order to enter the factory calibration mode it is necessary to enter the number 1000. The calibration mode is locked out with the entry of a number other than 1000 or after a power-on reset. Program protection must be "OFF" in order to make this entry.

Code number 1000

5.7.2 Maximum Velocity

Velocity at Cal Factor

QmaxDN velocity 10 m/s

This parameter is used to select either 10 m/s or 33.33 ft/s as the velocity corresponding to Cal factor. Span calibration adjustments of both frequency and current outputs are to be made with this parameter selected to 10 m/s and the Span Adjust display set to indicate flow in "%".

Select 10DS3110 in Section 3.3.18.3.

5.7.2.1 Span Adjust-Forward Flow

Span Adjust forward flow (shown below as not adjusted).

NOTE

The Converter range should be changed to correspond with the "Cal Factor" value for any of the remaining steps.

span adjust > F 97.35%

This parameter determines the calibration of both the display and the scaled pulse output and may be set by two different methods. First, a value may be entered manually when the following menu appears following the "Enter" operation:

Span adjust > F manual ?

The proper value is that which will cause the display readout to indicate 99.90% of the cal factor with an input of 9.99 m/s. This number is present on the converter data tag affixed to the power transformer on the Converter assembly and will be valid unless there has been replacement of analog circuit hardware.

In order to automatically adjust the span, a flow simulator type D55XC2000 with adaptor for the ac Converter must be available. Applicable test wiring is shown in Figure 5-1. The Simulator must be set to 9.99 m/s and switched to the forward flow mode. After scrolling to the "automatic" menu item and pressing "Enter", the adjustment progresses and the display will show:

>F>F>F>F>F
>F>F>F>F>F

After a few seconds the adjustment is completed and the Converter reverts to monitoring mode; the display reading will be 99.9% (+/- 0.1%). Push the "↑" button to display the value computed such as:

Span adjust >F
97.35%

After approximately 20 seconds the Converter will return to monitoring mode.

5.7.2.2 Span Adjust - Reverse Flow

Span adjust <R
-97.5%

This adjustment is performed in the same manner as that for the forward direction except that in the automatic mode the simulator is to be set at 9.99 m/s "Reverse". Refer to span adjust -forward flow (5.7.2.1) for instructions.

5.7.3 Zero Adjust

Zero adjust
5.0 Hz

In order to manually set zero, enter an input of "0.10" m/s FWD, and note the reading obtained. Then enter an input of "0.10" m/s REV, and note the reading obtained. Enter a value into the "Code 1000" Zero adjust menu which ultimately causes these readings to be equal and opposite.

Example:

Enter an input of 0.10 m/s FWD = Output.98% of 10 m/s span
Enter an input of 0.10 m/s REV = Output -1.04% of 10 m/s span
Enter an input of -3 Hz as a manual zero.
Outputs will then be +/- 1.01% respectively.

5.7.4 Adjust lout

5.7.4.1 Adjust lout at 100 %

For HART applications, the use of a 50HC1000 Hand-Held Computer is recommended. For non-HART applications select I=0-20 mA in submenu 3.3.19.

Adjust lout Value at 100% of range setting

Adjust lout 100%
100.0

Read the D.V.M., convert to percent of a 99.9% output and enter this value.

Example: When the above menu was selected, the value measured across the 250 ohm resistor was 5.056 volts. This value divided by the nominal value of 4.995 volts (19.98 mA x 250) yields the corrected value that must be entered, which is 101.22. In equation form, this becomes:

$$\frac{\text{Measured Value} \times 100}{\text{Nominal Value}} = \text{corrected value (in \%)}$$

5.7.4.2 Adjust lout at 20 %

Adjust lout value for 20% of range setting

Adjust lout 20%
20.000

Follow the procedure similar to that outlined in paragraph 5.7.4.1, but with an input signal of 2.00 meters/second and with a nominal value of 1.0 volts.

$$\frac{\text{Measured Value} \times 20}{\text{Nominal Value}} = \text{corrected value (in \%)}$$

NOTE
When all calibration steps are completed, record the respective data and keep it with the Converter for future reference.

Select previous flowmeter configuration in Section 3.3.18.3.

5.7.5 Calibration - F&P use only

Calibration
off

5.7.6 Adjustment of Integrators

pre-set by F&P

5.7.7 Range DN

Range DN - fixed/programmable

Range DN
programmable

The range DN can be entered by direct entry (programmable). In the programmable mode a further choice regarding the velocity at the cal factor (33.33 ft/s) or meter capacity (10 m/s) can be made. (Refer to paragraph 5.7.2 Maximum velocity).

5.7.8 Flow Direction

Flowdirection
forward/reverse

The converter offers bidirectional as well as forward only flow measurement. If the converter is in the forward mode, the parameters Range R, Pulse factor R and Multiplex Display are not available.

5.7.9 Instrument Number

Instrument no. 0

All converters have a factory installed sequential number, reflecting their relative time of manufacture.

5.7.10 Mains Interrupt

Records the number of times the unit has been powered

Mains Interrupt 0

5.7.11 Reset

** RESET **

This function executes a " warm " CPU hardware reset, after which switch positions, hardware options, etc. are polled. This function is normally completed whenever power is applied to the Converter. The power line interrupt counter is not incremented and the code number is not cleared when "RESET" is invoked.

5.7.12 Output data

<p>NOTE</p> <p>Before initiating this function, verify that the communication mode in the data link submenu is set to "ASCII". If this is not done, the Converter will hang up and suspend all signal processing until the power is cycled off and on.</p>
--

This function outputs all the Converter's configured data in plain ASCII text to both the Converter display and the data link simultaneously. This can be useful in establishing data link protocol or saving all device parameters.

5.7.13 Initialization

The last item in the calibration menu sequence is "Initialization". If this item is selected all parameters are set to the default values, replacing the factory-installed settings. Therefore, extreme caution should be exercised in using "Initialization". In general, "Initialization" need only be performed if there has been a loss of data in NVRAM and/or EEPROM memory. If a record of the calibration data is available from the tag, the data should be re-entered following the initialization. Otherwise, the unit must be calibrated again to place it back to within specified accuracy.

5.7.14 Analog Range

1 m

Indicates relative flow velocity signal in m/s (1m, 2m, 4m, 8m)

5.7.15 Excitation

Excitation 60 Hz

Measures power line frequency (50 or 60Hz).

6.0 MAINTENANCE

6.1 General Discussion

As the 50SM Signal Converter is a microprocessor based instrument, all computations, data manipulation and sequencing operations are software controlled. Display of flow rate and the cumulative total flow are performed automatically concurrent with flow through the associated Magnetic Flowmeter. As the Magnetic Flowmeter has no moving parts that are subject to mechanical wear and the Signal Converter has no operating controls that require field adjustment, there are no recommended periodic tests to be performed. As a result, routine system maintenance is not required.

If in the course of operation the Signal Converter does not perform as expected, it is common for the operator to first suspect that the software configuration is faulty. Although this may occasionally be true, it should be emphasized that the EPROM and NVRAM memory devices used in the Signal Converter are highly reliable. Should a malfunction be evident, see if the CPU light located on the keypad is energized. When the CPU light is energized steadily (not blinking), it is probable that the microprocessor and associated memory devices are functional. In this case, proper operation of the Magnetic Flowmeter should be established before troubleshooting the Signal Converter. Proper operation of the Converter can be confirmed as described in the Calibration Section.

NOTE

Due to the complexity of troubleshooting micro-processor based instruments, maintenance below the assembly level is not recommended.

If troubleshooting of the Signal Converter assembly is attempted, it should be noted that many of the CMOS type IC chips used in this assembly are static sensitive devices that can be internally damaged if not handled properly. Also, caution must be used when connecting test probes, as even a momentary accidental short may damage or destroy an integrated circuit. Further, although protection is provided against electro-static effects by built-in circuitry, the following precautions should be taken if it is necessary to handle the 50SM Converter pc assembly:

- 1) Ground all test equipment.
- 2) Technicians should use grounding-type wrist straps.
- 3) The surface of the service bench should be grounded to preclude static electric build-up.
- 4) All CMOS devices should be stored or transported in materials that are anti-static (do not use ordinary plastic wraps or bags). Typically, protection of the Converter assembly can be effected by first covering the pcb assembly with aluminum foil and then providing an outer wrap of heavy paper.

When a system malfunction is evident, the first step is to determine whether the problem is hardware or software related. If the Signal Converter appears to respond normally to functional operations such as those expected to occur during the course of parameter monitoring, self test procedures, etc., and system constants can be verified as correct, but the displayed process values are wrong, then proper operation of the primary meter should be verified.

When the Signal Converter exhibits total failure (no display can be obtained on the LCD), then possible loss of the external power source or an internal hardware malfunction could be the cause. A volt-ohm analysis will quickly indicate whether the problem is external or internal. Use of a conventional V-O-M is considered adequate for voltage and resistance analysis. An electronic frequency counter and oscilloscope will also be useful for verifying the output frequency rate, signal tracing, etc.

In the event of a hardware malfunction, a replacement Converter assembly can be quickly substituted for the defective assembly, thereby minimizing system downtime. F&P Company offers a factory repair/exchange program to facilitate replacement of a defective electronics module, i.e., the complete Signal Converter assembly. Under this repair/exchange program a fixed price will be charged to the account of the customer for replacement of defective equipment, with appropriate credit issued when the repairable unit is received by F&P (shipping charges prepaid).

NOTE

When communicating with F&P in regard to a replacement Converter, it is important to reference the complete instrument serial number and model number to assure that the correct replacement assembly will be provided.

The serial number and model number are given on the F&P manufacturing specification sheet and on the instrument data tag (attached to the Converter base). Should the proper procedure for solving a service problem become questionable, it is suggested that users contact their local F&P service facility for technical assistance.

Refer to Figures 6-1 and 6-2 to compliment the following discussion.

6.2 Signal Converter Disassembly

Should it be necessary to disassemble the Signal Converter for troubleshooting and/or replacement of a defective assembly, proceed as outlined below.

6.2.1 Removing the Signal Converter from the base

WARNING

Equipment powered by an ac line service constitutes a potential lethal electric shock hazard. Installation and servicing of the Magnetic Flowmeter and Signal Converter should only be attempted by a qualified electronics technician. Make certain that the power input leads are disconnected from the operating circuit before attempting electrical connections.

- 1) To remove the Converter cover, unscrew the four mounting screws located in the corners of the cover. These are captive-type screws and should not be removed from the cover. Store the cover for reassembly.
- 2) On top of the Digital board, unscrew the four screws that pass through the standoffs located near the corners of the Converter assembly. Lift the Converter assembly carefully so that the interconnecting terminal connectors between the Converter assembly and the terminal board in the base will not be damaged. Save all mounting hardware.

6.2.2 Disassembly of the Signal Converter

To gain access to optional plug-in assemblies located on the Analog Board, it is necessary to separate the Analog and Digital boards as outlined below.

- 1) Unscrew the four hex nuts that secure the Digital board to the standoffs. Save all hardware.

The Digital board can then be lifted slightly and tilted up (away) from the Analog board.

- 2) If it is necessary to separate the Analog and Digital boards, disconnect the interboard cable.

The Converter assembly can be reassembled by performing the above procedure in reverse order.

NOTE

Removal of the keypad/display assembly for service does not effect the operation of the Converter. If necessary, the Converter can be configured from a remote terminal without the keypad/display assembly being on the Converter.

6.3 Troubleshooting

The following series of tests may be performed on the Signal Converter module to determine problem areas. If proper Converter operation cannot be achieved when these steps are completed, then it should be assumed that the Converter has a failed component, most of which are not field replaceable. It is assumed that persons following this procedure are thoroughly familiar with operation of the device and that the entire magnetic flowmeter system has previously operated correctly. Servicing of the Signal Converter should only be attempted by a qualified electronics technician.

NOTE

It is possible to place incorrect data into the Converter when using the MICRO-DCI binary interface. If this interface has been used to change parameters, verify that all Converter data is within proper limits before continuing troubleshooting.

NOTE

If the action in response to a given problem does not result in correct Converter operation, it may be assumed that the Converter module is defective and should be replaced.

6.3.1 Procedure

Typical troubleshooting procedures are outlined below. The appropriate course of action is indicated by " * ".

1. System has no output, display and CPU LED not illuminated:

- * Check power fuse on Converter assembly.
- * Verify power input source is operational and that the applied voltage is correct.

2. No characters present on display:

- * Adjust contrast by inserting a small screw driver in the Contrast port on the keypad and turning the screw driver.

3. Error messages appear on display instead of the normal flow rate and totalization information:

- * Attempt to determine the source of any error message. Error code numbers are defined in Section 3.4.
- * Check system interconnection wiring for loose connections, open or shorted cable(s), etc.

4. Garbled information or missing characters appear on the display:

- * Execute the display self-test. Assuming no other problems exist, the Converter can operate without a display. However, no data can be changed except via a data link option.

5. Converter output does not appear to be correct but display information seems OK:

- * Move to the "SELF-TEST" menu and execute the I_{out} and F_{out} functions. The Frequency self-test will also produce an active pulse output. Refer to Section 3.3.21.

6. Error message "ERROR - EXCITATION":

- * Check for proper reference voltage (± 50 to ± 150 mV rms at test points TP102 and TP101).

- * Check magnet coil wiring (in Flowmeter) for proper circuit resistance.

- * Cycle Converter power off and on.

7. CPU LED is flashing (it should be on continuously):

- * Cycle Converter power off and on.

8. Error message "NVRAM Defect" appears on display:

- * Go to parameter "Upload from EEPROM" and then check all parameters.

- * If still incorrect, log all process parameters (range, damping, totalizer factors, etc.) and enter the "code 1000" mode. Step to the "INITIALIZE" menu and press "ENTER". Manually load all calibration parameters back into the Converter as they appear on the tag attached to the side of the power transformer mounted on the Analog board.

NOTE

If the Initialize routine is invoked, the Converter must have calibration data reentered. Refer to Section 5.0.

9. Error message "A to D OVERLOAD" appears in display:

- * Check for incorrect range, non-full pipe, excessive flow noise, incorrect reference, improper grounding, excessive dc voltage on meter electrodes.

- * Apply a short circuit between primary terminals 1, 2, and 3. The current output should drop to less than 3% of calibration factor (Range DN).

10. Converter does not appear to be in calibration:

- * Using the D55XC2000 Flow Simulator (refer to Section 5.3), apply input signals representing various points along the range. If the Converter checks out properly, the problem may be in the primary, or system interconnection wiring may be defective.

11. "Empty Pipe" message appears on display when pipe is known to be full or does not respond when pipe empties:

- * Re-verify set-up of empty pipe detector

12. Data link communication does not take place properly:

- * Invoke the data link self-test after connecting the Converter receive line(s) to the transmit line(s). This is a temporary connection for test purposes (not applicable to HART Protocol).

For the RS485 link, place a jumper between terminals T- and R-,
and another jumper between T+ and R+.

For the RS232-C link, place a jumper between terminals TD and RD.

6.3.2 Test Point (TP) Information

The following test points are located on the Analog board (refer to Figure 6-2).

TP101 = Signal common

TP102 = Reference voltage (50 - 150 mV rms)

TP105 = Input signal X 5

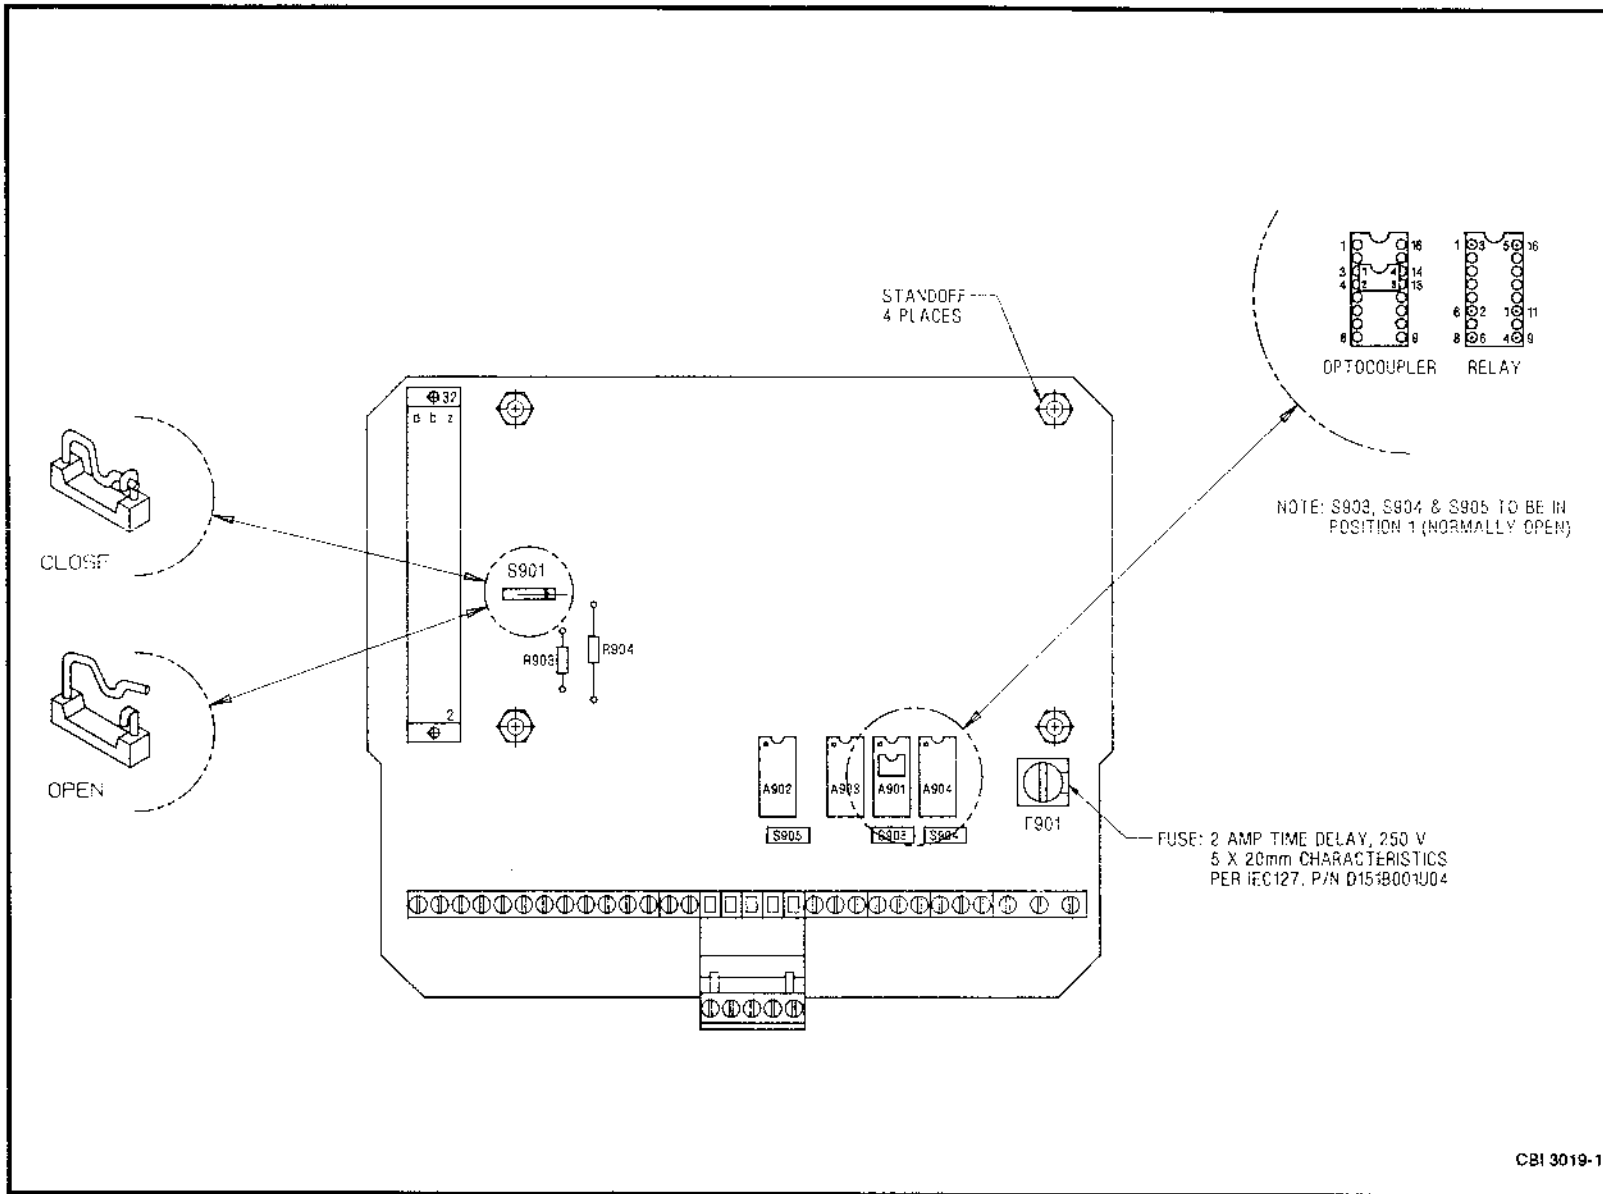


FIGURE 6-1. TERMINAL BOARD LAYOUT

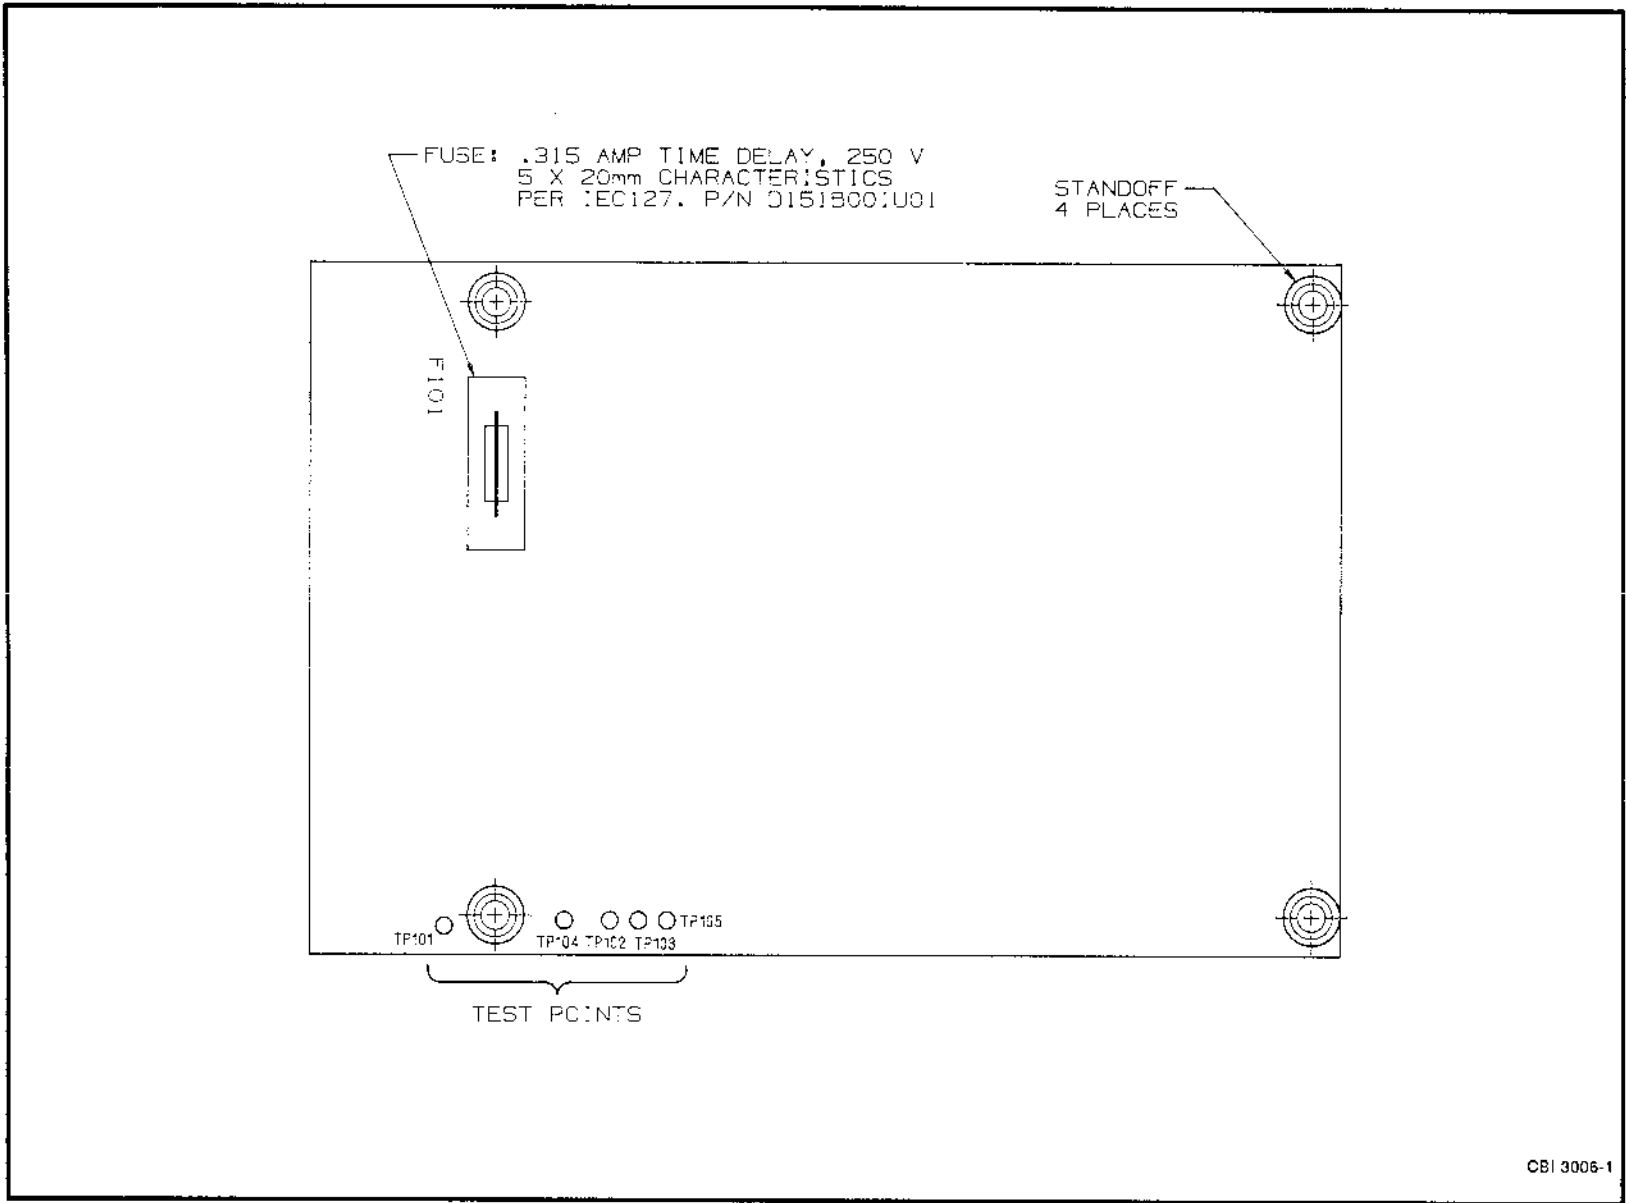


FIGURE 6-2. ANALOG BOARD LAYOUT

6.4 Parts List

When communicating with F&P in regard to replacement of a Signal Converter, it is important to refer to the complete instrument model number and serial number to assure that the correct replacement will be supplied. The model number and serial number are provided on the instrument data tag.

<u>Part Number</u>	<u>Description</u>
D674A326U19	Signal Converter Plug-in Module 115 V ac 50/60 Hz
CD674A326U51	Signal Converter Plug-in Module 115 V ac 50/60 Hz with Empty Pipe Detection
D674A406U01	Signal Converter Plug-in Module 115 V ac 50/60 Hz with HART PROTOCOL
CD674A406U51	Signal Converter Plug-in Module 115 V ac 50/60 Hz with HART PROTOCOL and Empty Pipe Detection
CD685A290U01	Pulse Output Board
D685A299U01	RS485 Board
D685A287U01	RS232 Board
674B073U01	Reset Switch Kit
677C003U01	10DS3000 Series Signal Cable, 50 feet (15 m)
677C003U01	10D1400 Series Signal Cable, 50 feet (15 m)
D163B013U01	Relay
177B486U01	Optocoupler
161S187U02	965 ohm resistor for 1000 ohm applications
161S187U01	33.2 ohm resistor for 1000 ohm applications
161S188U01	80 ohm resistor for 81 ohm applications
161S093U01	1 ohm resistor for 81 ohm applications
151B001U01	Fuse (analog board) 0.315 A time delay, 250 V 5X20 mm characteristics per IEC 127
151B001U04	Fuse (terminal board) 2 A time delay, 250 V 5X20 mm characteristics per IEC 127

DOCUMENTATION QUESTIONNAIRE

Your answers to the questions below and other comments assist us in publishing better documentation. If an answer requires explanation please use the space provided. All comments and suggestions become the property of Eltag Bailey Process Automation.

1. Title of Document? INSTRUCTION BULLETIN 50SM1000B, PN 24486A

2. Does this document meet your needs? _____

3. Is the information:

Easily understandable? _____

Properly organized? _____

Complete? _____

Sufficiently illustrated? _____

OTHER COMMENTS

(Please include page and/or figure number.)

Name _____

Address _____

No postage necessary
if mailed in the U.S.A.

If Bailey employee, please include
department number.

FOLD 1



NO POSTAGE
NECESSARY
IF MAILED
IN THE
UNITED STATES

BUSINESS REPLY MAIL
FIRST CLASS PERMIT NO. 86 WARMINSTER, PA



POSTAGE WILL BE PAID BY ADDRESSEE:

**BAILEY-FISCHER & PORTER
DEPARTMENT 261 / A2
125 EAST COUNTY LINE ROAD
WARMINSTER, PA 18974**

Attention: Technical Publications

FOLD 2

STAPLE
HERE

Our more than 6,000 professionals worldwide are ready to meet your needs for Strategic Enterprise Management...

Australia

Bailey-Fischer & Porter
Regents Park, NSW
Telephone: 61-2-645-3322
Telefax: 61-2-645-2212

Belgium

Fischer & Porter NV
Wilrijk
Telephone: 32-3-828-05-11
Telefax: 32-3-827-87-28

Brazil

Bailey do Brasil
Sao Paulo
Telephone: 55-11-548-4122
Telefax: 55-11-547-0315

Canada

Elsag Bailey (Canada), Inc.
Burlington, Ontario
Telephone: 1-905-639-8840
Telefax: 1-905-639-8639

Fischer & Porter (Canada) Ltd.
Downsview, Ontario
Telephone: 1-416-667 9800
Telefax: 1-416-667 8469

China

Bailey Beijing Controls
Beijing
Telephone: 86-1-401-0651
Telefax: 86-1-401-1643

Finland

Fischer & Porter Oy
Espoo
Telephone: 358-0-859-3133
Telefax: 358-0-859-3324

France

Elsag Bailey SA
Massy
Telephone: 33-1-64-47 2000
Telefax: 33-1-64-47 2016

Otic-Fischer & Porter

Clermont-Ferrand
Telephone: 33-73-93-84 10
Telefax: 33-73-93-03 65

Germany

Bailey-F & P Automation
Overath
Telephone: 49-220-473-90
Telefax: 49-220-473-979

Germany

Bailey-Fischer & Porter
Göttingen
Telephone: 49-551-905-0
Telefax: 49-551-905-777

Italy

Elsag Bailey
Genoa
Telephone: 39-10-658-2-944
Telefax: 39-10-658-2-941

Fischer & Porter Italiana

Milan
Telephone: 39-2-92771
Telefax: 39-2-9231257

Japan

Bailey Japan Company, Ltd.
Tagata Gun, Shizuoka-Ken
Telephone: 81-559-49-3311
Telefax: 81-559-49-1114

Jordan

Bailey Controls Jordan
Amman
Telephone: 962-6-756-908
Telefax: 962-6-756-908

Mexico

Bailey-Fischer & Porter
Naucalpan
Telephone: 52-5-557-6100
Telefax: 52-5-557-7022

Netherlands

Bailey-Fischer & Porter
Gorinchem
Telephone: 31-1830-34811
Telefax: 31-1830-30285

Norway

Bailey Petrovest AS
Bergen
Telephone: 47 55-229-601
Telefax: 47-55-229-610

Russia

Bailey Avtomatizatsiya
Moscow
Telephone: 7-095-973-3664
Telefax: 7-095-973-2317

Singapore

Elsag Bailey Pte. Ltd.
Singapore
Telephone: 65-442-3200
Telefax: 65-442-2700

Spain

Fischer & Porter España
Madrid
Telephone: 34-1-415-2200
Telefax: 34-1-415-3950

Sweden

Fischer & Porter AB
Stockholm
Telephone: 46-8-23-42-15
Telefax: 46-8-641-91-25

United Kingdom

Bailey ICS plc
Telford, Shropshire
Telephone: 44-952-670-477
Telefax: 44-952-670-455

Fischer & Porter Ltd.

Workington, Cumbria
Telephone: 44-946-830611
Telefax: 44-946-833003

United States

Bailey Controls Company
Wickliffe, Ohio
Telephone: 1-216-585-8500
Telefax: 1-216-585-8756

Bailey-Fischer & Porter Co.
Warminster, Pennsylvania
Telephone: 1-215-674-6000
Telefax: 1-215-674-7183

Venezuela

Bailey de Venezuela SA
Valencia
Telephone: 58-14-405-138
Telefax: 58-41-322-994

Turbine Control Systems

Electronic Technology Systems, Inc.
New Kensington, Pennsylvania USA
Telephone: 1-412-335-1300
Telefax: 1-412-335-2450

Energy Management & SCADA Systems

Network Management Technology, Inc.
Sugar Land, Texas USA
Telephone: 1-713-274-5000
Telefax: 1-713-240-6986

Liquid Analysis Products

TBI-Bailey Controls
Carson City, Nevada (USA)
Telephone: 1-702-883-4366
Telefax: 1-702-883-4373

TBI-Bailey



NMTI