

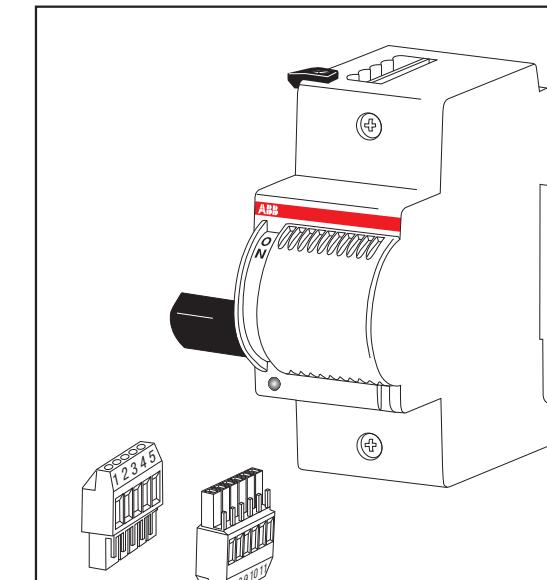
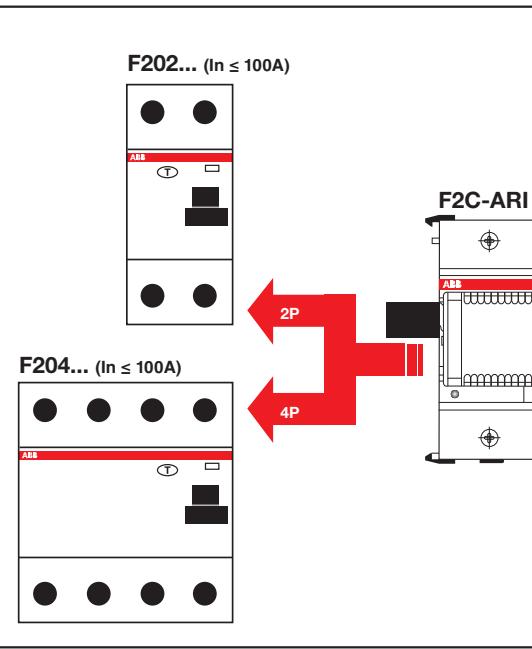
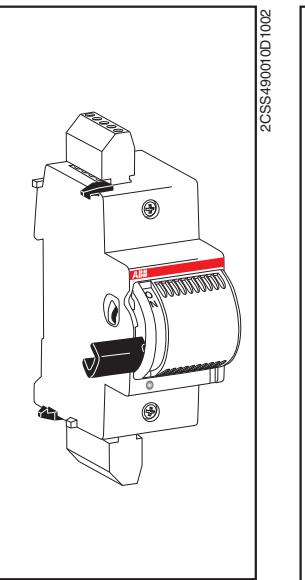
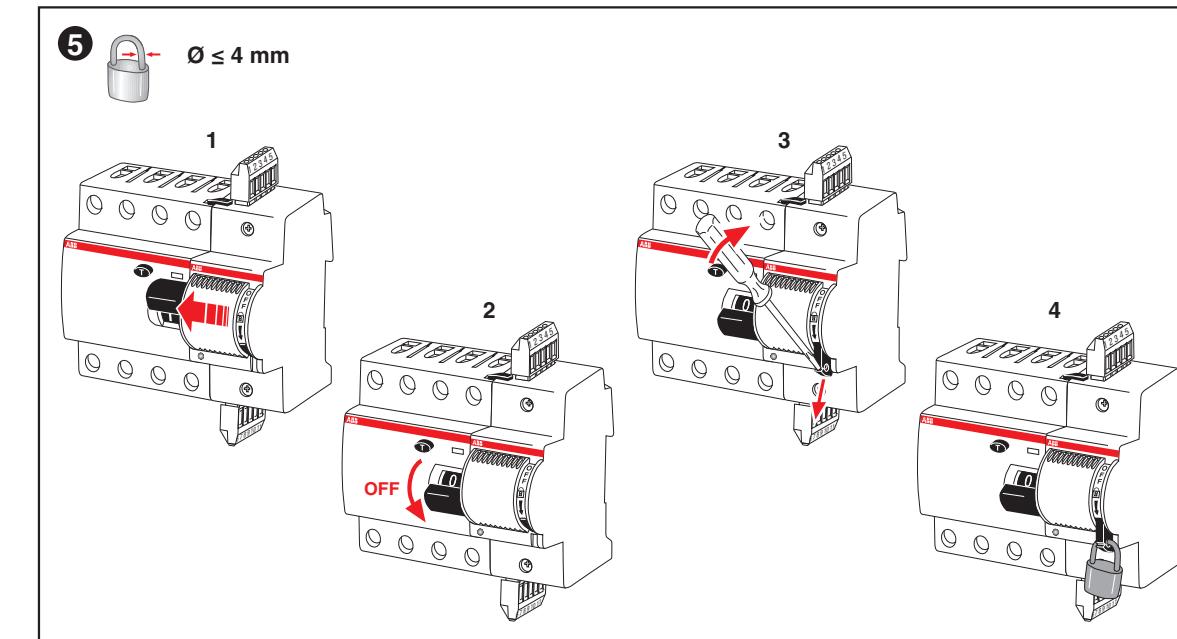
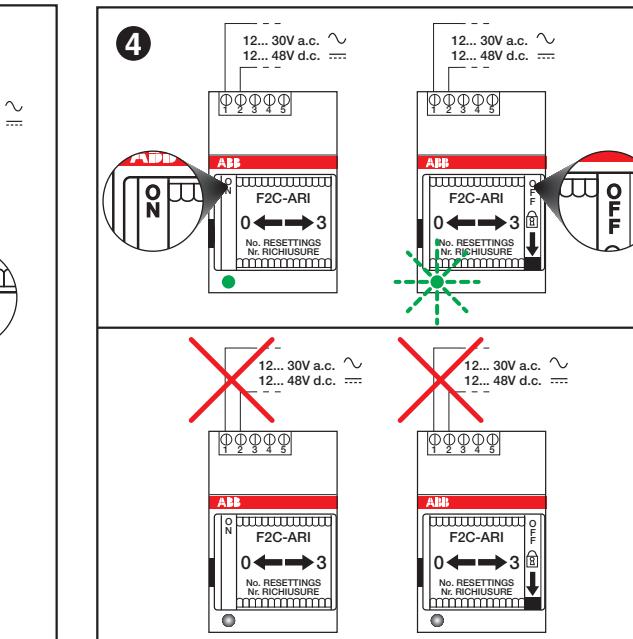
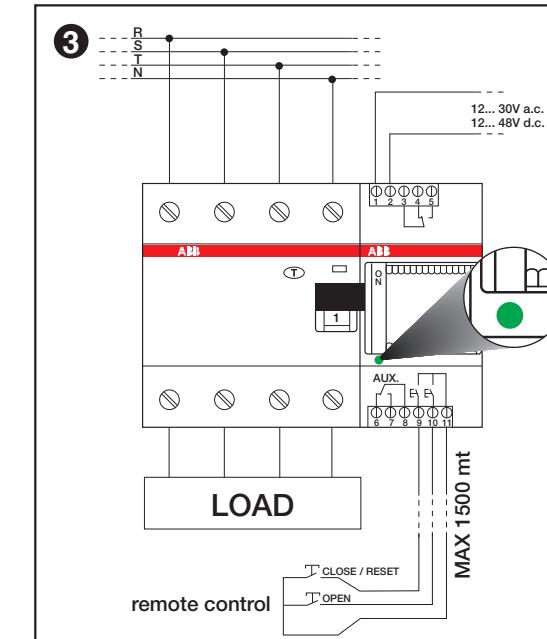


F2C-ARI

- I** Unità di riarmo automatico per F200
- GB** Automatic resetting unit for F200
- D** Selbstrückstelleinheit für F200
- F** Unité de réarmement automatique pour F200
- E** Reconnectadora por F200

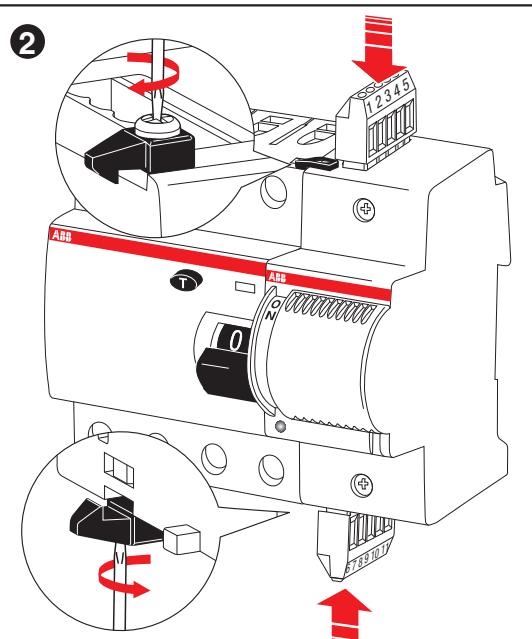

CE **ABB**

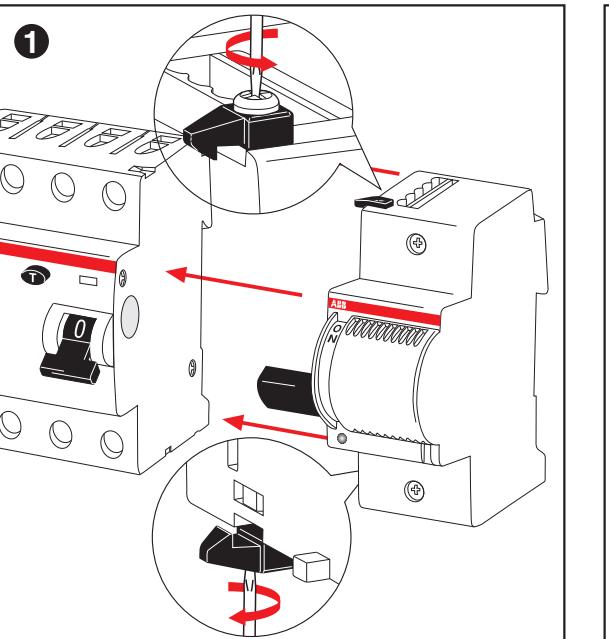

Alimentazione/ Supply/ Stromversorgung/ Alimentation/ Alimentación	12...30 V a.c. +10% -15% (50-60Hz) 12...48 V d.c. +10% -15%	-25 ... +55 °C	Comando a distanza Remote control Fernsteuerung Commande à distance Par medio de contactos sin tensión	Mediane contatti liberi da tensione By means of dry contacts Durch potenzialfreie Kontakte Par les contacts libres de tension Por medio de contactos sin tensión
Numero tentativi richiusure automatiche Number of automatic reclosing attempts Anzahl der automatischen Rückstellungsversuche Nombre de tentatives de réarmement Número de intentos de reconexión	3			
Tempo di reset del contatore numero richiusure automatiche Counter reset time Rückstellzeit des Zählers für automatische Rückstellungen Temps de reset du nombre de réarmements automatiques Tiempo de reset para el contador de reconexiones	12 sec	≤ 1500 m	Morsetti di comando Remote control terminals Steuerklemmen Bornes de commande Terminales de mando	Morsetto 9 contatto di chiusura e di reset remoto dello stato di blocco closing and remote reset contact for locked state Kontakt für Ferneinschaltung und Fernrücksetzung contact à fermeture et de réarmement à distance pour l'état de blocage contacto de cierre y reset remoto del estado de bloqueo
Potenza assorbita durante la manovra Power consumption during operation Leistungsaufnahme während der Betätigung Consumación pendant la manoeuvre Potencia absorbida durante la maniobra	12 V a.c. 24 V a.c. 30 V a.c. 12...48 V d.c. < 15 VA < 22 VA < 25 VA < 20 VA	≤ 2,5 mm ²		Morsetto 10 contatto di apertura Opening contact Klemme 10 Ausschalt-Kontakt Contact 10 contact à ouverture Terminal 10 contacto de apertura.
Contatto di segnalazione dello stato di blocco dopo tre tentativi di richiusura (morsetti 3 - 4 - 5) Power consumption at rest Aufgenommene Ruheleistung Consumation au repos Potencia absorbida en reposo	1,5 VA	1NA + 1NC (in scambio / change-over contact/ Wechsler Kontakt / contact inverseur / contacto comutado)		Morsetto 11 comune per i contatti di comando, +5V c.c. common reference for control contacts, +5V d.c. Klemme 11 Gemeinsame Quelle für Steuerkontakte, +5V d.c. (geliefert aus dem Fernantrieb) Contact 11 commun pour les contacts des commandes, +5V d.c. (fourni par le commande moteur) Terminal 11 comun por contactos de mando, +5V d.c. (tension suministrada por el mando motor).
Tempo di attesa per l'attivazione della richiusura automatica Waiting time between auto-reset attempts Wartezeit zwischen den automatischen Rückstellungsversuchen Temps d'attente entre deux tentatives de réarmement Tiempo de espera entre los intentos de reconexión	3 sec			
Tempo di chiusura a temperatura ambiente Closing time at ambient temperature Einschaltzeit bei Umgebungstemperatur Temps de fermeture à température ambiante Tiempo de clíere a temperatura medio ambiente	≤ 1 sec	5A (250V a.c.) (carico resistivo / ohmic load / ohmsche Last / charge ohmique / carga óhmica)		
Tempo di apertura a temperatura ambiente Opening time at ambient temperature Offnungszeit bei Umgebungstemperatur Temps d'ouverture à température ambiante Tiempo de apertura a temperatura medio ambiente	≤ 0,5 sec	1NA + 1NC (in scambio / change-over contact/ Wechsler Kontakt / contact inverseur / contacto comutado)		
Numero di manovre Number of operations Anzahl Befüchtigungen Número de manœuvres Número de maniobras	≤ 20.000	3A (250V a.c.) (carico resistivo / ohmic load / ohmsche Last / charge ohmique / carga óhmica)		

